

## **Briefing Report**

Subject:	Northbrook Swimming Pool
Reason for briefing note:	To ascertain the future of Northbrook Swimming Pool
Responsible Officer:	Catherine Hill
Date:	24 <sup>th</sup> January 2025

#### **SUMMARY**

Despite extensive efforts to drive income and footfall at Northbrook Swimming Pool since the leisure services were brought back in house in 2020, usage and revenue figures have seen little improvement. Combined with a projected increase in repairs and on-going costs to maintain the building, the future management of the building by Exeter City Council has become unsustainable.

#### 1. BACKGROUND

- 1.1 Northbrook Swimming Pool is a 19-metre community pool located in Beacon Heath, Exeter. It is currently part of a wider portfolio of council run leisure centres and was taken back in house by the council in September 2020 following the end of contract with a privately run leisure management company.
- 1.2 Northbrook Swimming Pool has 83 registered monthly/annual leisure members, who also benefit from cross centre usage at other swimming pools in the leisure portfolio, namely Riverside Leisure Centre and St Sidwell's Point Leisure Centre.
- 1.3 Northbrook Swimming Pool has 636 registered casual users who pay per visited session, who also benefit from cross centre usage at other swimming pools in the leisure portfolio, namely Riverside Leisure Centre and St Sidwell's Point Leisure Centre.

#### 2. INCOME

- 2.1 Since 2020 Northbrook Swimming Pool has generated a membership revenue total of £105,798.56.
- 2.2 Since 2020 Northbrook Swimming Pool has generated a casual user revenue total of £34,446.51.
- 2.3 Since 2020 Northbrook Swimming Pool has generated a block booking/club revenue total of £59,913.06 (see Appendix A)



#### 3. USAGE

- 3.1 Since 2020 Northbrook Swimming Pool has seen **5617** visits by members.
- 3.2 Since 2020 Northbrook Swimming Pool has seen **6842** visits by causal users.

(see Appendix B)

#### 4. SALES AND MARKETING CAMPAIGN DRIVES

- 4.1 Since 2020 Northbrook Swimming Pool has had a total of 13 targeted sales and marketing campaign drives, aimed at attracting new members to the centre, and encouraging increased use by existing members and casual users. (see Appendix C).
- 4.2 Since 2020 Northbrook Swimming Pool has had three membership price changes, increasing from £15, then £29.80, then to £30.70 in an attempt to increase membership income.

#### **5. ONGOING MAINTENACE ISSUES**

5.1 There are several current maintenance issues ongoing at Northbrook Swimming Pool. (see Appendix D)

#### **6. EXPENDITURE**

- 6.1 Total expenditure to date of £66,845.12 relating to general maintenance repair at Northbrook Swimming Pool to keep the building operational. (see Appendix E)
- 6.2 Total expenditure relating to staff pay, premises, supply and services and transports totals £819,444 to date. (see Appendix F)
- 6.3 Unfortunately, general repair maintenance is no longer sustainable, and the centre needs extensive whole building repair works.
- 6.3.1 Cost to reduce carbon emission by 72% **c. £850,000**. (see Appendix G)
- 6.3.2 Cost to bring the centre up to a reliable and efficient operational industry standard **c.£700,000** (allowing for inflation) (see Appendix H)
- 6.4 It was noted during an internal audit by the EDI Taskforce Group that Northbrook Swimming Pool is non-compliant in relation to the Disability Discrimination Act (DDA) as there are no disabled facilities on site for either staff or public. Northbrook Swimming Pool requires major investment to ensure the building meets the requirements of the Disability Discrimination Act (DDA) by providing a disabled changing room and platform lift of £450,000 £550,000.



## APPENDIX A – INCOME

Table 1: Total Income from April 2021 to date, split by membership and casual activity.

## **Total Income**

April21-Dec24

Membership	£105,798.56
Adult Swim	£22,256.00
Junior Swim	£3,415.83
Aqua Classes	£8,774.68
Block Booking	£59,913.06

Total £200,158.13

NB: Northbrook Swimming Pool didn't open in 20/21 due to restrictions-imposed on the leisure industry post covid.



## APPENDIX B – USAGE

Table 2: Total usage figures at Northbrook Swimming Pool from April 2021 to date, split by members and casual users.

# **Total Usage**

April21-Dec24

Members 5617 Casuals 6842			
	Members	5617	
Total 12459	Casuals	6842	
Total 12/159			
	Total	12459	



#### **APPENDIX C - SALES AND MARKETING CAMPAIGN DRIVES**

Table 3: Total number of sales and marketing campaign dives with overview, reach and attendance figures at Northbrook Pool since April 2021

Campaign Name	Date	Overview	Campaign Assets	Social media/App reach	Attendance	
Summers In 28 <sup>th</sup> swims t August the sum		Reduced rate junior swims throughout the summer holidays	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	10,077	58	
Fun Splash Session Trial	27 <sup>th</sup> – 31 <sup>st</sup> March 2023	Trialling new general fun splash swim sessions. Standard price for all ages	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	10610	21	
Fun Splash Sessions	31 <sup>st</sup> May- 2 <sup>nd</sup> June 2023	General swim sessions during May half term with floats provided. Standard price for all ages	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	11651	25	
Summer Splash Sessions	31 <sup>st</sup> July – 1 <sup>st</sup> September 2023	General swim sessions during the summer holidays with floats provided. Standard prices for all ages	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	15332	134	
Sid's Summer Swim Challenge	7 <sup>th</sup> August - 3 <sup>rd</sup> September 2023	Stamp card challenging them to come in for 6 swims to win a free goodie bag. Standard price for all ages.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	7874	87	
Halloween Sid Appearance	23 <sup>rd</sup> – 29 <sup>th</sup> October	October Half Term - appearance from Sid the Dog Standard price for all ages.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	535	91	
Festive Family Swim Sessions	27 <sup>th</sup> -29 <sup>th</sup> December 2023	General swim sessions with appearances from Sid the Dog. Free gift for every junior swimmer. Standard price for all ages.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	6794	48	
Half Term Swim Club	12 <sup>th</sup> -18 <sup>th</sup> February 2024	Stamp card initiative for juniors to complete for a certificate. Sid the Dog appearances.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	12208	31	





		Standard price for all ages.			
Sid's Easter Swim Club	29 <sup>th</sup> March - 14 <sup>th</sup> April 2024	Stamp card/certificate and activity sheet and easter egg trail. Standard price for all ages.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	7949	45
May Half Term Swim Club	27 <sup>th</sup> May- 2 <sup>nd</sup> June 2024	Stamp cards, certificate and activity sheet. Standard price for all ages	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	6709	33
Sid's Summer Splash Club	7 <sup>th</sup> August - 1 <sup>st</sup> September 2024	Stamp cards, certificate and activity sheet. Standard price for all ages	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	5011	61
Sid's Spooky Halloween Hunt October – 3 <sup>rd</sup> November 2024		Halloween-themed activity sheet and pumpkin trail around the centre. Standard price for all ages.	Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	2607	14
Sid's Christmas Swim Club	d's 21 <sup>st</sup> Christmas-th hristmas December activity shee		Social Media (Facebook/Instagram) Exeter Leisure App Exeter Leisure Website Posters/leaflets	2783	13



## **APPENDIX D – CURRENT MAINTENACE ISSUES**

Table 4: Current maintenance issues at Northbrook Swimming Pool

Maintenance Issue	Notes
Male showers	Closed due to leak through tiles into electrics in plant room below.
	Requires tanking and re-tiling.
Disable access	Steps to the main door and steps to pool – disable access is through fire
	door, no provision for male disabled users to change
Pool Hall AHU	Extract failed prior to 2020 and unit modified. Working to keep
	operational but is end of life, keeps going off, struggles to
	maintain/recover temp in colder periods. Needs new burner – Wemco
	sourcing
Boiler	End of life but trying to keep operational
Front Doors	Wood is rotten and has been filled and supported on a number of
	occasions, movement of frame has resulted in glass cracking twice in
	past year. Single glazed and commented on in Decarb report.
Ongoing small repairs	Currently end of life
to fabric and pipes	



## **APPENDIX E - MAINTENACE EXPENDITURE**

Table 5: Total maintenance expenditure at Northbrook Pool since 2021

Row Labels	2021	2022	2023	2024	<b>Grand Total</b>
AD-HOC MAINTENANCE		1,864.38	30.00	2,598.48	4,492.86
CARPENTRY				520.40	520.40
ссту	3,729.00	863.91	237.60		4,830.51
CENTRAL ALARM SERVICE	527.52	583.19			1,110.71
ELECTRICAL REPAIRS	5,334.92	4,035.92	1,010.00	1,787.00	12,167.84
ELECTRICAL TESTING - BLOCKS	150.00	777.40		115.12	1,042.52
EMERGENCY LIGHT TESTING				225.00	225.00
FIRE ALARM TESTING	232.00				232.00
FIRE EQUIPMENT MAINTENANCE			37.05		37.05
FIRE RISK ASSESSMENT	2,085.00			1,131.38	3,216.38
GAS & CENTRAL HEATING		459.00			459.00
GENERAL MAINTENANCE	2,628.26	380.00		2,942.82	5,951.08
GLAZING			144.50		144.50
HEATING REPAIRS	3,279.61	1,104.21	553.00	164.50	5,101.32
OTHER REACTIVE REPAIRS		869.86	3,198.73	206.78	4,275.37
PLANNED MAINTENANCE	6,757.50	3,986.77		1,089.45	11,833.72
PLUMBING REPAIRS	2,414.81	1,796.30	2,940.99	1,343.30	8,495.40
SERVICE CHARGES	359.65			334.81	694.46
WALL / STRUCTURE REPAIRS			65.00		65.00
Grand Total	27,498.27	17,870.94	9,016.87	12,459.04	66,845.12



## **APPENDIX F - EXPENDITURE**

Table 6: Total other expenditure including all costs associated to Northbrook Swimming Pool

		21/22	22/23	23/24	24/25 (to 15/01/25)	TOTAL
		£	£	£	£	£
1 – PAY		100,389	112,534	103,188	136,505	452,615
3 – PREMISES		83,629	74,676	118,273	68,571	345,149
4 - SUPPLIES & SERVICES		3,978	11,795	2,224	3,212	21,209
5 – TRANSPORT		412	0	0	59	471
	TOTAL	188,408	199,004	223,685	208,347	819,444



## APPENDIX G - CURRIE AND BROWN DECARBINISATION REPORT



**Exeter City Council** 

Northbrook Swimming Pool

Beacon Lane, Exeter EX4 8LZ

# **Decarbonisation Strategy Report**





## Revision control

Rev	Date	Description of revision	Prepared by	Checked by	Authorised by
1.0	05.10.2023	First issue	AH	KC	KC

## Contact details

Ky Cheal, Director

D 01752 278 100 M 07123 123456 E Ky.Cheal@curriebrown.com

Currie & Brown Limited Poseidon House Neptune Park Plymouth, PL4 0SN

Ayrton Hemmens, Building Surveyor

D 01752 278 100 M 07807 985482 E Ayrton.Hemmens@curriebrown.com Currie & Brown Limited Poseidon House Neptune Park Plymouth, PL4 0SN

Paul Chamberlain, Principal Electrical Engineer

D 02922 803 973 M 07590 849229 E Paul.Chamberlain@sdolution.co.uk

SDS Engineering Consultants Unit 6D, Quest House St. Mellons Business Park Cardiff CF3 0EY

Alex Giltrow, Intermediate Mechanical Engineer

D 01275 872 963 E Alex.Giltrow@sdolution.co.uk

# Contents

Exec	cutive summary	1
1. 1.1 1.2 1.3 1.4	About the Survey	2 2 2
<ol> <li>2.1</li> <li>2.2</li> <li>2.3</li> </ol>	Site Details  Location  Site Description  Usage	4 4
3.1 3.2 3.3	Existing Site Energy UseGas Data  Electric DataBenchmarking Energy Data	5 5
<b>4.</b> 4.1	Northbrook Swimming Pool – Main Building	8
4.2	Existing Mechanical and Electrical Installations  4.2.1 Heating and Hot Water installations  4.2.2 Electrical Supply and Infrastructure  4.2.3 Lighting	11 13 13
	Decarbonisation Proposal	15 18 20
4.4	Proposal summary	23
5.	Conclusion	25
Арре	endix A	26
Low-	-carbon heating system options appraisal	26
Арре	endix B	28
Disp	lay Energy Certificate (DEC)	28
Арре	endix C	29
Risk	Register.	29

## **Executive summary**

There are opportunities to significantly improve Northbrook Swimming Pool as part of Exeter City Councils decarbonisation strategy. This has been documented within this report as a 3-stage project proposal.

At stage 1, it was found that energy demand could be reduced by implementing fabric and LED upgrades to achieve an annual 15% carbon emission reduction compared to existing.

Implementing stage 2, this could be further reduced by 65% with the introduction of an air source heat pump (ASHP) which would eliminate fossil fuel consumption on site.

Then at stage 3, a further 10% carbon emission reduction could be made by installing PV panels in which additional electricity demands from the ASHP could be offset.

Overall, total carbon emissions can be reduced by 73% compared to existing.

The following table provides a summary of the full decarbonisation strategy in which anticipated expenditure and associated savings are detailed.

Proposals	Estin	nated Project Costs	Electrical Usage	Fossil Fuel Usage	Energy Saved Type	Carbon Emissions	Carbon Saving (Annual)	Carbon Saving	Energy Saving (Annual)	Energy Saving (Annual)	Carbon Savings	Payback
		£	kWh	kWh		tCO2	tCO2	tCO2eLT	kWh	£	£/tCO2eLT	Years
Baseline			59,221	650,270		128.5						
Lighting	£	19,350	56,510	650,270	Electric	128.0	0.52	13.1	2,711	£ 670	£ 1,477	28.9
Roof upgrades	£	85,350	56,510	640,989	Gas	126.3	1.67	50.1	9,281	£ 454	£ 1,703	188.1
Wall upgrades	£	3,800	56,510	633,689	Gas	125.0	1.31	39.4	7,300	£ 357	£ 96	10.6
Windows	£	162,900	56,510	563,174	Gas	112.3	12.69	355.4	70,515	£ 3,448	£ 458	47.2
Doors	£	16,850	56,510	557,023	Gas	111.2	1.11	31.0	6,151	£ 301	£ 544	56.0
Rooflights	£	12,950	56,510	546,878	Gas	109.4	1.83	51.1	10,145	£ 496	£ 253	26.1
Draught-proofing	£	-	56,510	533,034	Gas	106.9	2.49	72.9	13,844	£ 677	£ -	-
ASHP (FF contribution)	£	584,500	56,510	-	Gas	10.9	95.95	1,918.9	533,034	£ 26,065	£ 305	22.4
ASHP (Elec contribution)			200,019	-	Electric	38.7	- 27.75	- 555.0	- 143,509	-£ 35,461	£ -	-
PV System	£	23,800	179,395	-	Electric	34.7	3.99	89.7	20,624	£ 5,096	£ 265	4.7
Total	£	909,500	179 , 395	-		34.7	93.8	2,066.7	530,096	£ 2,103	£ 440	432.5

Due to the age and condition of the existing fossil fuel heating system, the full project proposal is **COMPLIANT** under PSDS Phase 3 criteria in which an application can be made to receive funding towards heat decarbonisation.

The following table portrays the estimated available funding that could be received in a successful PSDS Phase 3 application.

Proposals	Estimated Project Costs	Carbon Saving (Annual)	Carbon Saving	Energy Saving (Annual)	Carbon Savings	Payback	Available funding	Additional Funding Requirement	% of project Salix Funded
	£	tCO2	tCO2eLT	£	£/tCO2eLT	Years	(£325 tC02eLT)	£	%
Proposal 1 - Full Proposal	£909,500	93.8	2,066.7	£2,103	£ 440	432	£800,360	£109,140	88%

# 1. About the Survey

#### **1.1** Brief

Futures, Currie & Brown and SDS Engineering Consultants have been appointed to provide baseline energy analysis and decarbonisation strategy reports for Exeter City Council. This report details findings from a site survey and investigation into adopting low carbon technology on site, including load modelling and technology appraisals. These outputs are intended to direct the energy upgrade and carbon reduction opportunity, including applying for the Public Sector Decarbonisation Scheme grant (PSDS) through Salix. The PSDS scheme offers grant funding for decarbonisation projects that meet specific eligibility criteria.

This process requires completion of an energy analysis spreadsheet with embedded persistence factors and carbon calculations. The locked calculations have some bias towards technologies that Salix have prioritized through the Public Sector Decarbonisation Fund. Our results therefore look to compare our modelling of operational performance with those within the Salix application form to ensure that Exeter City Council understand revised operational expenditure as well as capital expenditure.

This report details decarbonisation strategy for Northbrook Swimming Pool.

## **1.2** Survey Details

- The site survey was carried out by Currie & Brown on: 11/09/2023
- The site survey was carried out by SDS Engineering on: 11/09/2023

#### 1.3 Limitations

- Our site surveys were limited to a visual inspection only, no intrusive investigations were undertaken.
- Where insulation levels such as within cavity walls or within roof construction could not be confirmed, we have assumed insulation levels to be comparable to minimum building regulation levels at the time of construction with refence to the guidelines provided within the Standard Assessment Procedure (SAP 2012)
- Energy Analysis and benchmarking has been undertaken in accordance with CIBSE guidelines.

#### 1.4 Philosophy

The construction industry is required to comply with ever tightening legislation surrounding energy use within buildings. Currie & Brown's energy and sustainability consultancy team have been providing advice to the government with regards to proposed changes to the Building Regulations Approved Document L – Conservation of Fuel and Power and to the Climate Change Committee, the independent statutory body established under the Climate Change Act 2008. Currie & Brown are signatories to the World Green Building Council commitments and contributing authors to their recent report 'Beyond Buildings'.

The regulatory framework regarding energy use will become progressively more stringent over coming years, as designers Currie & Brown and SDS Engineering Consultants design and encourage organisations to go beyond current minimum levels in order to promote best practice, reduce operational costs and mitigate the effect of any potential future regulatory changes. Adopting a best practice approach provides the greatest contribution towards achieving the UK Governments ambitious net zero by 2050 target.

We suggest adopting the universally applied and well used energy hierarchy. This sets out the priority of measures for energy use reduction in order of which typically, can produce the greatest available improvements and the simplest to implement.

The three strategy headings are:

#### Be Lean

#### Be Clean

#### Be Green

Be Lean - reducing the demand of energy consuming appliances on site, wherever possible

Be Clean - using the best possible efficiency of equipment and using an energy source which produces the least emissions

Be Green - implementing renewable technology, generating heat or electricity from a renewable source

## 2. Site Details

#### 2.1 Location



Northbrook Swimming Pool, Beacon Lane, Exeter EX4 8LZ

#### 2.2 Site Description

Northbrook Swimming Pool is a public swimming pool facility within Exeter. There is one 19m internal pool located on site with changing rooms.

The Display Energy Certificate is attached to the report in Appendix B and provides a DEC rating of E.

Our energy assessment results often deviate from the DEC and advisory report as we have undertaken a more detailed investigation and analysis, focussing on the buildings which are responsible for the majority of the energy use across site. Temporary buildings and low energy users have been omitted from our calculations with relevant GIFA and assumed energy use omitted from the base data.

#### 2.3 Usage

The site is generally in constant use throughout the year including bank holidays but closed on Sundays.


The open hours are generally between 7:30 – 15:00 Monday to Friday and 08:00 – 12:00 Saturdays.

# 3. Existing Site Energy Use

Where available, we have analysed three years of accounts data consumption. As worst-case scenario, the highest consuming years have been used as the basis for benchmarking and proposal calculations.

#### 3.1 Gas Data


<sup>\*</sup>Only one year of energy consumption data available.

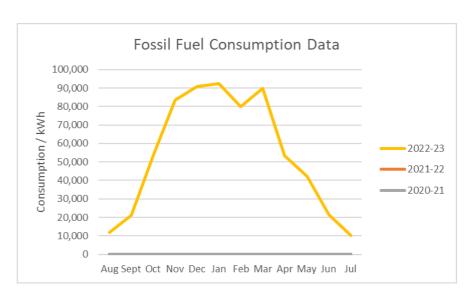

20	22-23
Month	Usage (kWh)
Aug	11,915
Sept	21,149
Oct	53,320
Nov	83,406
Dec	90,853
Jan	92,343
Feb	79,832
Mar	89,959
Apr	53,320
May	42,299
Jun	21,447
Jul	10,426
Total	650,270

#### 3.2 Electric Data

<sup>\*</sup>Only one year of energy consumption data available.

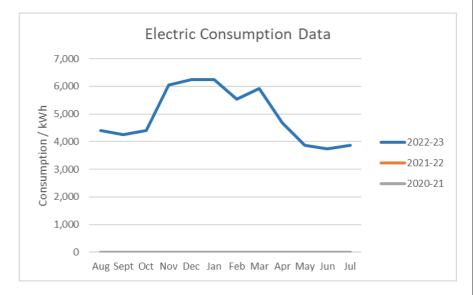

20	22-23
Month	Usage (kWh)
Aug	4,406
Sept	4,260
Oct	4,406
Nov	6,048
Dec	6,248
Jan	6,248
Feb	5,549
Mar	5,925
Apr	4,674
May	3,861
Jun	3,738
Jul	3,861
Total	59,221

Current Site Energy Costs								
		ssil Fuel ge (kWh)	Electricity Usage (kWh)					
Total	65	650,270		59,221				
Annual Cost	£	31,798	£	14,634				
Annual Carbon Emissions (Tonnes)		117.0		11.5				

Total Annual Cost	£46,432
Total Annual Emissions (Tonnes)	129


Energy tariff rates for gas and electricity have been based on BEIS GOV Energy Rates 2023 Q1 for non-domestic buildings. This may not be reflective of the site's actual energy tariff.

Gas = £0.049 / kWh Electricity = £0.25 / kWh

## 3.3 Benchmarking Energy Data

The following table and graph portrays the existing site energy consumption data (kWh/m²) against typical and good practice as described in CIBSE Guide F table 20.1.

<b>Building Type</b>	Leisure pool centre					
	Fossil fuels	Electric				
Good	573	164				
Typical	1321	258				
Actual	1248	114				

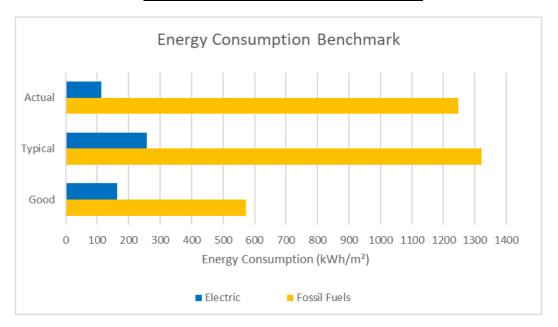

# 4. Northbrook Swimming Pool – Main Building


It is understood that Northbrook Swimming Pool was constructed in the late 1980's-early 1990's, originally with an external pool. The external pool was later enclosed around 1998 with new external walls and a roof. The site predominantly consists of the pool hall and male and female changing rooms. There is additional ancillary reception and small office space.

## Planning Restrictions

Our review of public records has indicated that Northbrook Swimming Pool is not subject to any listed status or located within a within a Conservation Area, under the Planning (Listed Buildings and Conservation Areas) Acts 1990. However, the installation of Air Source Heat Pumps in some local authorities are not considered under permitted development rights for non-domestic buildings. In such cases, a planning application would be required. We have not engaged with the local planning authorities at this stage.

#### Asbestos

The building was originally constructed and extended whilst some asbestos containing materials were still common in the construction supply chain. We have identified the block at MEDIUM-HIGH risk. The asbestos register has not been consulted.

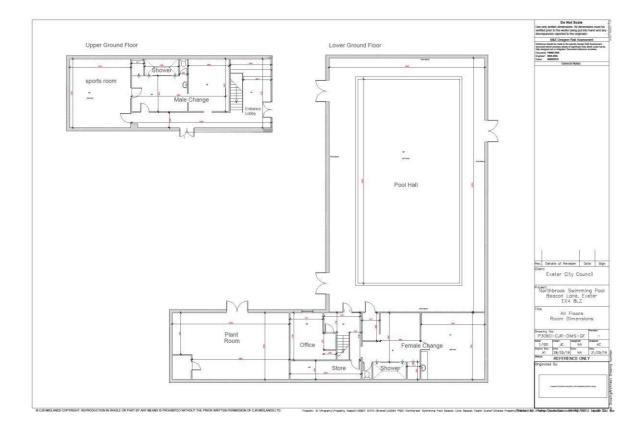

#### **4.1** Existing Building Fabric

#### Roof

The buildings main roof area is a flat roof structure with felt covering. The pool hall is covered with a curved pitched, steel roof structure. The level of insulation within both roof build ups could not be determined without intrusive investigations. We have therefore assumed insulation levels to be comparable to construction practice at the time of build.

Installing additional insulation within the roofs can significantly improve thermal performance. The felt covered flat roofs appear to be approaching the end of their service life where insulation upgrades can be suitably made. The pitched roof insulation is contained within the roof build-up, with improvement opportunities limited in terms of practicality. It is recommended the pitched roof areas are upgraded when the covering is next due for renewal.

#### Rooflights

There are some localised rooflights installed within the main building areas which are single glazed, Georgian wire installations. These are in poor condition, with cracked panes and contributing to significant heat loss comparted to modern alternatives.

It is recommended the rooflights are replaced with modern double-glazed alternatives.

#### Walls

The external walls are traditional masonry cavity wall construction throughout. Without undertaking any intrusive investigations, we have assumed the walls are insulated comparable to construction standards at the time of build.

Cavity fill wall insulation could be installed as a cost-effective measure to improve existing performance. It is recommended intrusive investigations are carried out to the existing walls to determine if they are insulated, the levels of insulation and overall condition. Cavity wall insulation could become defective from being incorrectly installed resulting in cold spots or damaged due to dampness which affects its thermal performance. Following investigations, an assessment can be made on its suitability

#### Windows

There are localised timber frame single glazed windows and a curtain wall section to the entrance lobby. The pool hall contains a half-height poly-carbonate glazed curtain wall to the pool area which includes openable aluminium double-glazed sections. These windows are contributing to significant heat loss compared to modern alternatives.

It is recommended the windows are replaced with modern installations throughout. We recommended the pool areas are upgraded to triple glazing with the remaining areas upgraded to modern double glazing.

#### Doors

The entrance doors are timber frame with single glazed vision panels and missing draught proofing measures. There are additional aluminium framed installations containing obscured vision panels. Generally, doors are weathered and installation resulting in increased air leakage and heat loss. External doors are of timber construction and dated in nature. Majority of doors have single glazed vision panels and are missing draught proofing measures contributing to heat loss

It is recommended the external doors are replaced with modern installations throughout with

integrated draught proofing measures.














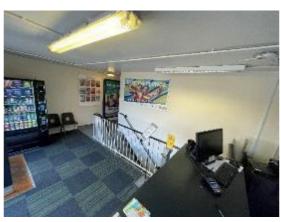



## **4.1.1** Fabric Heat Loss Calculations

The static heat load analysis below incorporates fabric loss, infiltration and thermal bridging. It is estimated there is an existing peak heat load of 71.6kW throughout the building.

				Fabric Heat Loss						Infiltration	Thermal Bridging	Total	Total + Margin						
				Heat Loss	Roof area	Heat Loss	Wall area	Heat Loss	Window	Heat Loss	Door area	Heat Loss	Rooflight	Heat Loss	Total Fabric	Heat loss	Heat loss	Total heat	Total heat
Asset Name	Floor	Temp(°C)	Grd floor area (m²)	(W)	(m <sup>2</sup> )	(W)	(m²)	(W)	area (m²)	(W)	(m²)	(W)	area (m²)	(W)	Loss (W)	(W)	(W)	loss (W)	loss (W)
Northbrook (Pool Hall)	0	21.0	310	697	328	2133	105	1184	110	8548	12	908	0	(	13469	39745	395	53608	58969
Northbrook (Remaining Areas)	0	21.0	103	1363	59	517	75	1124	2	288	6	413	13	1524	5229	2071	281	7580	8338
Northbrook (Remaining Areas)	1	21.0	$\backslash$		110	962	. 0	(	7	792	C	) (	0	(	1754	2184	C	3937	4331
																	Total (W)	65126	71638
																	W/m²	125	137

#### **4.2** Existing Mechanical and Electrical Installations

## **4.2.1** Heating and Hot Water installations

The central heating is supplied via a single 205kW Robin hood boiler that has been reconfigured in 1986 to include a gas burner. The heating within the pool space is supplied by an external Moducel AHU with a gas heater that has up to 55kW capability. The boilers supply wall mounted radiators around the building, domestic hot water calorifier and swimming pool.

The heating pipework is distributed to radiators which are located to the perimeter of the building under windows where available. The men's changing room and toilet appears to be naturally ventilated, whilst the women's changing room and toilet has an extract connected to the pool hall ventilation.

The building includes toilets and changing facilities with Domestic Hot Water Service (DHWS) generated from the boiler feeding an indirect calorifier within the plant room.

The boiler is an old Beeston robin hood boiler with no plate to identify the year of manufacture or initial set up of the boiler. Beeston boilers have been insolvent since 1976, so assumed this boiler is in excess of 47 years old with the Nuway Natural Gas Burner being installed in 1986. The heat generators are life expired, in a poor condition and in need of replacement. The systems within the plant room are generally in a poor condition and need numerous rectifications.

The radiators within the building are in a reasonable condition with minor aesthetic damage, however, could do with thermostatic radiator valves being installed to reduce energy consumption.

The age of the AHU is a minimum of 14 years old, based on the Powrmatic gas burner manufacture year of 2009. Upon inspection of the unit one of the fans is completely corroded through, no lights are visible despite the unit being in operation and is generally in an unacceptable condition. There is a fan within the plantroom that appears to be a replacement for the one corroded through, however the council have suggested this has been there for years. This unit, as a minimum, needs fans to be replaced and the gas burner replaced with a low carbon alternative.





Like-for-like Fossil Fuel System Replacement Cost

The age and condition of the existing fossil fuel heating system means it is economically viable to replace in the short-term due to being end of life.

PSDS Phase 3 funding calculation is partially influenced by the marginal cost of the like-for-like replacement and new low carbon system. The like-for-like cost of a replacement conventional fossil fuel system is £24,185.

A funding criteria of PSDS Phase 3 was conventional fossil fuel heating system must be at or coming to end-of-life. Under Phase 3 criteria, a Salix application would be eligible to provide a potential source of funding for heat decarbonisation works.

Capital Cost Conventional Fossil Fuel Boiler system							
System Size kWht	2	05					
Boiler	f 12,54	45					
Metering and Monitoring	£ 2,79	90					
BWIC	£ 2,2	50					
Remove Existing Boiler Plant	£ 4,3	50					
Flushing/Commissioning	£ 2,2	50					
Total	£ 24,18	35					
Price per kWp	£ 11	8					

## **4.2.2** Electrical Supply and Infrastructure

The electrical installation to the site is a three Phase / 400V 100A with a TN-C-S earthing arrangement.

The main incoming electrical supply and distribution is in a satisfactory condition.

A request for information has been submitted with the DNO regarding site upgrade, based on the current allowances it is likely that an upgrade in supply will be required. This is TBC upon the DNO providing further information.





## **4.2.3** Lighting

Lighting is a fluorescent throughout the building and would benefit from being upgraded to LED throughout.





## **4.3** Decarbonisation Proposal

Our decarbonisation proposal adopts a 'whole building approach' consisting of three key stages.

# Stage 1 Demand Reduction

Reduce existing energy demand by improving building fabric to reduce heat loss. Replace light fixtures for modern LED's.



#### Stage 2

#### **Low Carbon Heating System**

Replace existing end-of-life fossil fuel heating systems with low carbon alternative.



# Stage 3 Renewable Technology - PV

Install photovoltaic panels to offset additional electrical demand of low carbon heating system.

## **4.3.1** Stage 1

Stage 1 incorporates measures to reduce energy demand comprised of two parts; fabric upgrades and LED lighting replacement.

## **4.3.1.1** Fabric Upgrades

Asset	Works area	Works Proposal	Fuel Saved	Area	Install Cost	Install Cost Total	Lifetime	Annual Energy Savings	Annual Cost Savings	Payback	carbon saved
				m²	£/m²	£	Years	kWh/year	£/year	Years	kg/kWh
Northbrook (Pool F	Wall TYPE 1	Cavity wall insulation	Gas	105	13.50	£1,420	42.0	2,626	£ 128.41	11	472.7
Northbrook (Pool F	Window TYPE 1	Triple glazing	Gas	102	1,099.79	£111,848	28.0	58,389	£ 2,855.21	39	10,510.0
Northbrook (Pool F	Window TYPE 2	Triple glazing	Gas	9	1,099.79	£9,458	28.0	4,937	£ 241.44	39	888.7
Northbrook (Pool F	Doors TYPE 1	New door with draught proofing	Gas	12	750.00	£9,075	28.0	4,229	£ 206.78	44	761.1
Northbrook (Pool F	Draught-proofing	Draught-proofing (new windows/d	Gas	105	-	£0	29.3	9,799	£ 479.15	0	1,763.7
Northbrook (Rema	Roof TYPE 1	Re-roof (flat) with insulation	Gas	169	392.78	£66,380	42.0	9,281	£ 453.84	146	1,670.6
Northbrook (Rema	Wall TYPE 1	Cavity wall insulation	Gas	75	13.50	£1,011	42.0	4,674	£ 228.57	4	841.3
Northbrook (Rema	Window TYPE 1	Double glazing	Gas	9	785.56	£7,070	28.0	7,189	£ 351.55	20	1,294.0
Northbrook (Rema	Doors TYPE 1	New door with draught proofing	Gas	6	750.00	£4,125	28.0	1,922	£ 93.99	44	346.0
Northbrook (Rema	Rooflights TYPE 1	Double glazed rooflight	Gas	13	785.56	£9,977	20.0	10,145	£ 496.07	20	1,826.0
Northbrook (Rema	Draught-proofing	Draught-proofing (new windows/d	Gas	75	-	£0	29.3	4,046	£ 197.83	0	728.2
		TOTALS				£ 220,365		117,236	£ 5,733	38	21102

By implementing all proposed fabric upgrades there is an estimated carbon saving of 21.1 tonnes equating to approximately £5,733 per year to be made based on current tariff rates.

## Fabric Upgrade Projects

The below tables group fabric upgrades into building elements to take forward as fabric upgrade projects including all anticipated project costs. The anticipated energy savings are calculated on a accumulative basis, implementing each building fabric project proposal.

Project.	Roof upgrades
Actual kWh (Fossil Fuel)	650,270
kWh savings (Fossil Fuel)	9,281
After kWh savings (Fossil Fuel)	640,989
Design and engineering cost	£4,200
Main equipment capital cost	£36,500
Installation cost	£29,850
Project delivery cost	£7,050
Contingency	£7,750
Total project cost	£85,350

 Re-roof flet roof areas with greater insulated build-up.

Project.	Windows
Actual kWh (Fossil Fuel)	633,689
kWh savings (Fossil Fuel)	70,515
After kWh savings (Fossil Fuel)	563,174
Design and engineering cost	£6,300
Main equipment capital cost	£70,600
Installation cost	£57,750
Project delivery cost	£13,450
Contingency	£14,800
Total project cost	£162,900

- Replace all single glazing to main building areas with modern double glazing.
- Replace pool hall glazing and polycarbonate curtain walling with triple glazing.

curtain waining with triple glazing.						
Project.	Rooflights					
Actual kWh (Fossil Fuel)	557,023					
kWh savings (Fossil Fuel)	10,145					
After kWh savings (Fossil Fuel)	546,878					
Design and engineering cost	£700					
Main equipment capital cost	£5,500					
Installation cost	£4,500					
Project delivery cost	£1,050					
Contingency	£1,200					
Total project cost	£12,950					

 Replace Georgian wire single glazed rooflights with modern alternatives.

Project.	Wall upgrades
Actual kWh (Fossil Fuel)	640,989
kWh savings (Fossil Fuel)	7,300
After kWh savings (Fossil Fuel)	633,689
Design and engineering cost	£700
Main equipment capital cost	£1,350
Installation cost	£1,100
Project delivery cost	£300
Contingency	£350
Total project cost	£3,800

Install cavity fill wall insulation to external masonry walls.

Project.	Doors
Actual kWh (Fossil Fuel)	563,174
kWh savings (Fossil Fuel)	6,151
After kWh savings (Fossil Fuel)	557,023
Design and engineering cost	£700
Main equipment capital cost	£7,250
Installation cost	£5,950
Project delivery cost	£1,400
Contingency	£1,550
Total project cost	£16,850

 Replace all external doors thorughout with modern alternatives with integrated draught proofing measures.

Project.	Draught-proofing
Actual kWh (Fossil Fuel)	546,878
kWh savings (Fossil Fuel)	13,844
After kWh savings (Fossil Fuel)	533,034
Design and engineering cost	£0
Main equipment capital cost	£0
Installation cost	£0
Project delivery cost	£0
Contingency	£0
Total project cost	£0

 Draught proofing improvements made as part of window and door replacement works.

## Lighting LED upgrade

It is proposed that all the existing lighting should be changed to a modern LED equivalent. Lighting models would be available to directly change the fittings currently in use to avoid any wider internal builders work changes.

It has been assessed that approximately 4,744kWh of the current electrical demand (59,221 kWh) is due to lighting. The capital cost for the installation is estimated to be £15,650. The final installation cost is estimated to be £19,350.

Project.	Lighting
Actual kWh (Electric)	59,221
kWh savings (Electric)	2,711
After kWh savings (Electric)	56,510
Design and engineering cost	£350
Main equipment capital cost	£8,600
Installation & commissioning cost	£7,050
Project delivery cost	£1,600
Contingency	£1,750
Total project cost	£19,350

Stage 1 - Fabric Improvement & Lighting									
		ssil Fuel ge (kWh)		ricity Usage (kWh)					
Total		546,878		56,510					
Annual Cost	£	26,742	£	13,964					
Annual Carbon Emissions (Tonnes)		98.4		10.9					

Total Annual Cost	£40,706	
Total Alliaal Cost	140,700	
Total Annual Emissions (Tonne	es)	109
<b>Energy Cost Reduction</b>	12%	£5,726
<b>Emissions Reduction</b>	15%	19

By implementing fabric improvements and lighting upgrades it is estimated a 15% carbon emissions reduction can be made.

#### **4.3.2** Stage 2

Stage 2 incorporates sustainable heating technology with the intention of omitting fossil fuel consumption.

#### Air Source Heat Pump

It is proposed to replace the current gas-fired boiler for heating to a refrigerant based heat pump equivalent, including the replacement of emitters with larger low temperature radiators suitable for heat pumps which produce a lower flow temperature.

The proposed location of the heat pumps is to the side of the plantroom. A suitable acoustic enclosure would be required to fence off the new heat pumps.

The current emitters shall be replaced with larger surface area emitters to cater for the reduction in flow temperature from the air source system.

Analysis of the electrical supply has shown that an upgrade to the incoming mains cable is likely necessary, and a new distribution board would be required for increased electrical consumption on-site with 2 no. heat pumps based on 100kW Three phase units, with an electric heat battery of up to 55kW to be supplied on the AHU.

2x 100kW R32 air source heat pumps will deliver low temperature hot water at 50 degrees to the central heating system via ancillary equipment in the mechanical plantroom. These units have a maximum efficiency / Seasonal coefficient of performance (SCOP) of 2.6

The current boiler would be decommissioned, with the new ancillary heating equipment, including circulation pumps, heat exchanger, control panels located. The new mains will then connect to the existing distribution from this location

The heat pump system would then heat the building using entirely electrical power, therefore, to offset the increase in electrical consumption we would strongly suggest the system is implemented alongside solar electricity generated on site.

A new zonal control, sensor and valve arrangement shall be included with the installation to minimise energy use.

The site has an existing three Phase 400V 100A electrical supply. The maximum demand to the site is unknown currently but the DNO has been contacted for further information. Given the proposal for 2 no. heat pumps running at 100kW each and an electric heater battery, it is assumed there is not enough supply capacity.

A provisional allowance has been included within our cost build up for the local site electrical upgrade. Further upgrades are subject to confirmation from DNO engagement.

The installation of the heat pumps will displace 533,034 kWh of annual gas usage and 71 tonnes of CO2. The capital cost of the installation is estimated to be £451,600. The final installation cost is estimated to be £584,500.

Project.	ASHP
Actual kWh (Fossil Fuel)	533,034
kWh savings (Fossil Fuel)	533,034
After kWh savings (Fossil Fuel)	0
Design and engineering cost	£31,500
Main equipment capital cost	£248,350
Installation & commissioning cost	£203,200
Project delivery cost	£48,300
Contingency	£53,150
Total project cost	£584,500

Stage 2- Heat Pump									
Fossil Fuel Usage after ASHP installation (kWh)		ectricity ge (kWh)	Additional Heat Pump Power (kWh)		Pump Power   Net Electri		t Electricity port (kWh)		
0		56,510	143,509			200,019			
Annual Cost	£	13,964	£	35,461	£	49,425			
Annual Carbon Emissions (Tonnes)		10.9		27.8		38.7			

Total Annual Cost		£49,425
Total Annual Emissions (Tonnes)		39
Energy Cost Reduction	-21%	-£8,719
<b>Emissions Reduction</b>	65%	71

By implementing an ASHP it is estimated a further 65% carbon emissions reduction can be made. Due to the additional electricity demand, energy cost is likely to increase by approximately £8,719 annually.

#### **4.3.3** Stage 3

Stage 3 is intended to offset additional electrical consumption demand developed from stage 2 by installing PV panels.

#### Solar PV

There is the possibility to benefit from solar energy using the available roof space by installing up to 54no. PVs in a Southwest facing arrangement – this would be an installed capacity of 21.6kWp. This would likely displace the energy used on site, help reduce bills and support the Government's climate drive.

To utilise the roof area of the site and produce solar PV electricity, it is proposed to install a PV system with a peak generation of 21.6 kW with losses accounted for, there is the opportunity to generate and reduce electricity import by 20,624kWh annually.

This would reduce equivalent carbon emissions by 4 tonnes per year and is estimated that this could reduce electricity import costs (at 2023 prices) by £5,096.

This survey was conducted remotely based on site information and was deemed to be safe for the installation of PV. Due to the age and nature of the building and surrounding area conservation consent maybe required for the installation of PV.

For G99 and district network operator (DNO) considerations, there shall be local voltage and frequency control for export to the grid in moments of excess power generation. A G99 application will need to be completed as part of the installation process by the DNO.



PV arrangement for Northbrook Swimming Pool

#### **Battery Storage for Solar PV**

There is a possibility to add battery storage to the proposed solar PV array, to enable the site to benefit from the storage of the excess solar energy that is generated when the site is closed, or the buildings demand has dropped below that of the size of the PV array.

The PV battery would harness power that would normally be exported to the grid in these peak conditions. The battery storage would also provide power for a short period in times of power cuts or loss of power to the main incoming supply.

The battery storage unit could be located on the external wall of the building. The PV array would be directly coupled to be battery to ensure all the supply from the PV is used to supply the battery and the swimming pool directly. This ensures the most optimal use of the PV energy to charge the battery. Carbon reduction would depend on the base load and load provide of the swimming pool and may vary depending on the size of PV array. Further investigations maybe required to optimise the size of battery storage to the demand of the site.

Project.	PV System
Actual kWh (Electric)	200,019
kWh savings (Electric)	20,624
After kWh savings (Electric)	179,395
Design and engineering cost	£1,400
Main equipment capital cost	£10,050
Installation & commissioning cost	£8,250
Project delivery cost	£1,950
Contingency	£2,150
Total project cost	£23,800

By introducing the PV array, carbon emissions can be further reduced 10%.

Overall total carbon emissions can be reduced by 73% on site compared to existing by implementing all 3 proposal stages equating to 94 tonnes of CO2 annually.

## **4.4** Proposal summary

The below table details a summary of the identified decarbonisation proposal for Northbrook Swimming Pool. The total project costs, payback and equivalent carbon emissions savings are detailed.

Proposals	Esti	mated Project	Electrical	Fossil Fuel	<b>Energy Saved</b>	Carbon	Carbon	Carbon	Energy	Energy	Carbon	Payback
		Costs	Usage	Usage	Туре	Emissions	Saving (Annual)	Saving	Saving (Annual)	Saving (Annual)	Savings	
		£	kWh	kWh		tCO2	tCO2	tCO2eLT	kWh	£	£/tCO2eLT	Years
Baseline			59,221	650,270		128.5						
Lighting	£	19,350	56,510	650,270	Electric	128.0	0.52	13.1	2,711	£ 670	£ 1,477	28.9
Roof upgrades	£	85,350	56,510	640,989	Gas	126.3	1.67	50.1	9,281	£ 454	£ 1,703	188.1
Wall upgrades	£	3,800	56,510	633,689	Gas	125.0	1.31	39.4	7,300	£ 357	£ 96	10.6
Windows	£	162,900	56,510	563,174	Gas	112.3	12.69	355.4	70,515	£ 3,448	£ 458	47.2
Doors	£	16,850	56,510	557,023	Gas	111.2	1.11	31.0	6,151	£ 301	£ 544	56.0
Rooflights	£	12,950	56,510	546,878	Gas	109.4	1.83	51.1	10,145	£ 496	£ 253	26.1
Draught-proofing	£	-	56,510	533,034	Gas	106.9	2.49	72.9	13,844	£ 677	£ -	-
ASHP (FF contribution)	£	584,500	56,510	-	Gas	10.9	95.95	1,918.9	533,034	£ 26,065	£ 305	22.4
ASHP (Elec contribution)			200,019	-	Electric	38.7	- 27.75	- 555.0	- 143,509	-£ 35,461	£ -	-
PV System	£	23,800	179,395	-	Electric	34.7	3.99	89.7	20,624	£ 5,096	£ 265	4.7
Total	£	909,500	179,395	-		34.7	93.8	2,066.7	530,096	£ 2,103	£ 440	432.5

This template has fixed performance criteria that may not be representative of in-operation performance. The total project value is estimated at £909,500 which aims to eliminate gas consumption on site.

#### **4.4.1** PSDS Salix Funding Opportunity

The classification of opportunity is based on assessment within the publicly accessible Salix application template. Under Phase 3 criteria, this proposal is **COMPLIANT** for Salix funding due to the condition of existing heating system. We recommend an application is targeted in the short-term for decarbonisation works.

The following table provides the estimated available funding allowance based on the full project proposal as recommended within this report. PSDS Phase 3 funding is focused on the decarbonisation of heat. Funding is granted up to £325 tCO2eLT CCT (carbon cost threshold) for the marginal cost of upgrading to a low carbon heating system and direct CO2 savings only. Applicants are encouraged to focus proposal measures with direct CO2 saving measures as this is what ultimately drives down the £/direct carbon savings, allowing more funding to be available within the £325 tCO2eLT threshold. A minimum client contribution of 12% is required.

Proposals	Estimated Project Costs	Carbon Saving	Carbon Saving	Energy Saving	Carbon Savings	Payback	Available funding	Additional Funding Requirement	% of project Salix Funded
		(Annual)		(Annual)				Requirement	runaea
	£	tCO2	tCO2eLT	£	£/tCO2eLT	Years	(£325 tC02eLT)	£	%
Proposal 1 - Full Proposal	£909,500	93.8	2,066.7	£2,103	£ 440	432	£800,360	£109,140	88%

In all scenarios we recommend undertaking the full decarbonisation proposal which aims to eliminate fossil fuel consumption on site incorporating both direct and in-direct carbon saving measures. This proposal is directed at taking a 'whole building approach' in which the largest contribution to 'net zero' aspirations can be made, ensuring carbon emissions and energy cost from both fossil fuel and electrical sources are reduced.

However, the following tables and graphs have been produced to provide the estimated available funding, project cost and proposed energy cost comparison by targeting reduced project proposals. The reduced proposals focus primarily on introducing a low-carbon heating system as the primary intervention and minimising overall project cost.


**Proposal 1** – Portrays the full decarbonisation strategy as recommended within this report which aims to eliminate fossil fuel consumption and minimise electrical consumption from site. A 'whole building approach' is implemented through fabric first upgrades prior to replacing the heating system, which is then supplemented by further technology demand reduction proposals such as LED and PV. This proposal has the largest contribution to net zero aspirations.


**Proposal 2** – Portrays a reduced proposal which focuses on the implementation of a low-carbon heating system, omitting the fabric first upgrades. Additional electrical demand is offset by introducing LED and PV upgrades to offset energy cost.


**Proposal 3** – Portrays a further reduced proposal which focuses solely on the implementation of a low-carbon heating system without undertaking any further upgrades.

# **4.4.2** Proposal Options Appraisal

Proposals	Estimated Project Costs	Carbon Saving (Annual)	Carbon Saving	Energy Saving (Annual)	Carbon Savings	Payback	Available funding	Additional Funding Requirement	% of project Salix Funded	
	£	tCO2	tCO2eLT	£	£/tCO2eLT	Years	(£325 tC02eLT)	£	%	
Proposal 1 - Full Proposal	£909,500	93.8	2,066.7	£2,103	£ 440	432	£800,360	£109,140	88%	
Proposal 2 - ASHP, PV &	£648,650	87.7	1,766.7	-£5,696	£ 367	N/A	£570,812	£77,838	88%	
Proposal 3 - ASHP Only	£605,500	83.2	1,663.9	-£11,462	£ 364	N/A	£532,840	£72,660	88%	

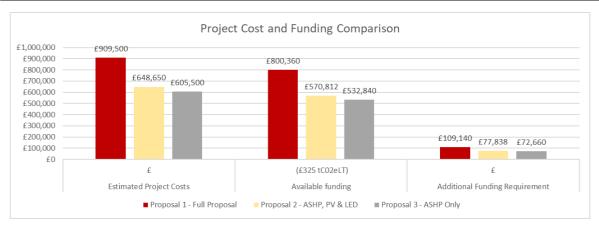

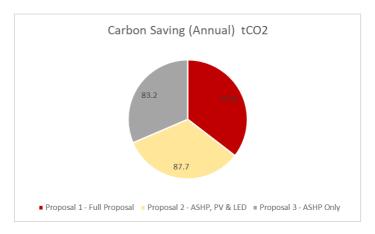

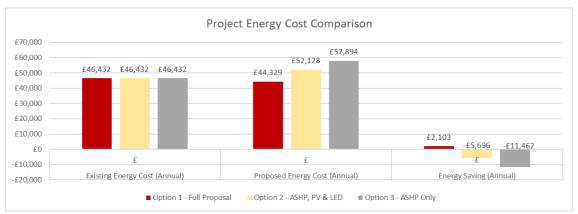


#### 5. Conclusion

Overall, there is good opportunity to implement decarbonisation measures at Northbrook Swimming Pool. This can be achieved through a combination of building fabric upgrades and renewable technology which can be utilised to reduce heat loss and energy consumption.

The existing fossil fuel heating system is end of life making it the optimal time to transition to a low-carbon heat source. This makes the works eligible under Salix PSDS Phase 3 criteria in which an application can be made to receive funding towards the heat decarbonisation works.

The following table shows the anticipated revised energy consumption for the site implementing the full project proposal. This identifies a strategy to omit fossil fuel consumption from site and minimise electrical demand.

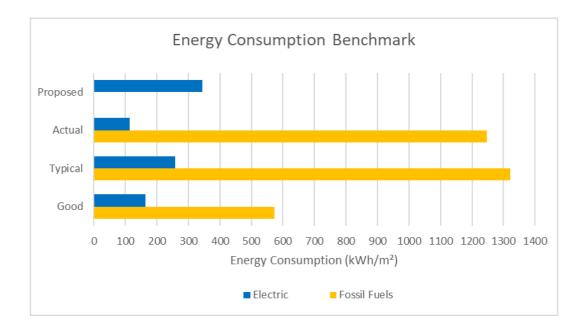

# Appendix A


Low-carbon heating system options appraisal.

Option 1			ion 1	Opti	ion 2	Option 3			
	Title	·	Heat Pumps	Ground Source He		Ground Source Heat			
	Description	Replacement of the existing fossil fuelled Air Source Heat Pumps (ASHPs)	•	Replacement of the existing fossil fuelled Ground Source Heat Pump Slinky (GSHP)	heating system with new sustainable	Replacement of the existing fossil fuelled heating system with new sustainable Ground Source Heat Pump Thermal Pile (GSHP).			
1	of the establishment whilst omitting fossil fuels for heat generation on site. In doing this, the project is contributing to the governments ambitious targets of acheiving net zero carbon by 2050. It is anticipated the ASHPs will be supplemented with solar panels to offset additional electrical demands. Whilst			Option to install GSHP will address space of the establishment whilst omitting foss doing this, the project is contributing to t acheiving net zero carbon by 2050. It is a supplemented with solar panels to offset it is anticipated this will entail sizable init ultimately reduce energy consumption coheating system is end of life making it the carbon heating system.	il fuels for heat generation on site. In the governments ambitious targets of nitcipated the GSHPs will be additional electrical demands. Whilst ial capital costs, the new system will osts for the site. The existing fossil fuel e optimal time to transition to a low-	Option to install GSHP will address space heating, DHW and pool heating needs of the establishment whilst omitting fossil fuels for heat generation on site. In doing this, the project is contributing to the governments ambitious targets of acheiving net zero carbon by 2050. It is anticipated the GSHPs will be supplemented with solar panels to offset additional electrical demands. Whilst it is anticipated this will entail sizable initial capital costs, the new system will ultimately reduce energy consumption costs for the site. The existing fossil fuel heating system is end of life making it the optimal time to transition to a low-carbon heating system.			
	Score (min 1 - max 5)		5		5		5		
Α	Weighted Score (0.7)		3.5	3	.5	3	.5		
		(Ecluding p	roject costs)	(Ecluding pr	roject costs)	(Ecluding p	roject costs)		
2	Project Capital Cost	ASHP Metering and Monitoring	£ 6,974	Ü	£ 2,790	Plant Room Metering and Monitoring	£ 110,300 £ 2,790		
		ASHP ancillaries Drainage		GSHP ancillaries Drainage	-	GSHP ancillaries Drainage	f 52,400 f 1,116		
		Radiators	£ 36,200	Radiators	£ 110,300	Radiators	£ 110,300		
		LTHW pipework	f 17,450	LTHW pipework	£ 17,450	LTHW pipework	£ 17,450		
		Domstic hot and cold water system	£ 32,500	Domestic hot and cold water system	£ 34,900	Domestic hot and cold water system	£ 34,900		
		Electrics and Controls	£ 65,650	Ground Array/Slinky pipe	£ 258,600	Thermal Pile	£ 386,000		
		BWIC			£ 65,650	Electrics and Controls	£ 65,650		
		Remove Existing Plant		BWIC	£ 15,700		£ 15,700		
		Flushing/Commissioning		Remove Existing Plant		Remove Existing Plant	£ 6,416		
		Electric ASHP cables		Flushing/Commissioning	-	Flushing/Commissioning	£ 4,050		
		Electrical Reinforcement		Electric GSHP cables		Electric GSHP cables	£ 10,471		
		Pool Pumps		Electrical Reinforcement		Electrical Reinforcement	£ 27,896		
		Air Handling Units / Fans (Provisional)	The state of the s	Pool Pumps	£ 6,500	Pool Pumps	£ 6,500		
		Heat Exchanger (Provisional)	£ 5,000	Air Handling Units / Fans (Provisional)		Air Handling Units / Fans (Provisional)	£ 42,000		
				Heat Exchanger (Provisional)	·	Heat Exchanger (Provisional)	£ 5,000		
	Total Cost	£451	1,590	£771	,	£898			
	Score (min 1 - max 5)		5		4				
В	Weighted Score (0.15)	0	.75	0	.6	0.	45		
3	Project Planning	Air Source Heat Pumps are the simplest of the three proposed low-carbon heat sources in terms of speed, cost and disruption. The site has viable locations these could be installed and appropriately secured. Dependant on local authority, installing air source heat pumps may require a planning application to be made which largley relates to the noise impact. The site is is close proximity to residential land uses.			ils to be laid out over a large area for las limited green space available that deemed the available space would be	Installing GHSP thermal piles can result i be managed due to the proximity of loca effectiveness of a thermal pile system is properties of the ground they are being undertaken at this stage. The further the more expensive it becomes.	l residential land uses. The dependant upon the thermal nstalled. No investigations have been		
	Score (min 1 - max 5)	1	4		2		3		
-	Weighted Score (0.15)		2.6		.3	3 0.45			
<b>—</b>						i S			
4	Total Weighted Score (A+B+C)		.85		.4		.4		
Ľ	Total Traighted Score (A.Bre)	4.	.03	4	.4	4	.4		

# Appendix B

Display Energy Certificate (DEC).

# Display energy certificate (DEC)

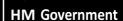

Legacy Leisure Northbrook Pool Beacon Lane EXETER EX4 8LZ Operational rating

Ε

Certificate number: 0970-6931-0171-7890-3060

Valid until: 29 December 2029

Total useful floor area: 573 square metres

Energy performance operational rating

The building's energy pe fo mance operational rating is based on its carbon dioxide (C02)  ${r \atop e} missions \ for \ the \ last \ year.$ 

It is given a score and an operational rating on a cale from A (lowest emissions) to G (highest emissions)

Th etypical score for a public building is 100. This typical score gives an operational rating of D.

Score	Operational rating	This building Typ	ical
0-25	A		
26-50	В		
51-75	C		
76-100	D		
			_
101-125	E	<u><i0s< u="">∈  </i0s<></u>	
126-150	F	10	0
150+	G		-

This building's energy use		
		Other fuels
Annual energy use (kWh/m2/year)	175	1262
Typic <b>a</b> energy use (kWh/m2/y ear)	245	986
Energy from renewables	0%	0%

Previous operational ratings	
	Operational rating
December 2019	105 E

Total carbon diox	Total carbon dioxide (CO2) emissions						
This tells you how			building				
Date	Electricity	Electricity Heating					
Dece rth er 2019	55	140	0				

Assessment details	
Assessor's name	Mrs. Tara Taylor
Employer/Trading name	Future Energy Performance 3 &
Employer/Trading address	5 lbstock Road, Ellistown 01530 453940
Assessor's declaration	Contractor to the occupier for EPBD services only.
Accreditation scheme	
Issue date Nominated	Elmhurst Energy Systems Ltd 25  March 2020
date	March 2020

30 December 2019

# Appendix C

Risk Register.

			Origina	al Risk					
No.	Category	Risk Description	Likelihood	Impact	Risk rating	Mitigation	Likelihood	Impact	Risk rating
1	Design	Current proposals based off assumptions currently to RIBA stage 2/3. Inaccuracies to specific site requirements possible.	3	4	12	Further design development is required to reach RIBA stage 4. Current proposal designed with assumptions with contingencies allowed for in costings.	2	4	8
2	Design	Structural integrity for roof to support solar PV.	2	5	10	Detailed on site structural review to happen upon appointment of design team. Potential structural upgrade works to be incorporated at design stage. Additional cost subject to survey findings.	1	3	3
3	Design	Building fabric works improving thermal performance and airtightness creating risk of condensation and ventilation.	3	4	12	Design solutions to be progressed to RIBA stage 4 upon appointment of design team. Designs to comply with building regulations guidance in Approved Document C and F.	1	4	4
4	Design	Risk of proposed works coming into contact with asbestos causing delay, high risk based on building ages.	5	5	25	Asbestos R&D surveys to be instructed as priority task during planning year. Separate programme of enabling works to be instructed for removal prior to project commencement. Investigative and asbestos enabling works will be self-funding by the client.	3	3	9
5	Planning	Project implementation timetable delays.	4	5	20	Close co-ordination with Main Contractor required upon appointment to agree construction programme with regular monitoring on-site to mitigate delays. Professional fees for project management has been included within the total project cost build-up to ensure effective management of the project.	2	4	8
6	Planning	SALIX, procurement. If project is progressed under SALIX finance, periods between application, confirmation of funding and delivery timelines can be problematic especially in an active school environment.	5	5	25	Project needs to commence quickly if progressed under SALIX finance route. The procurement process for this requires early Contractor selection and financial commitment. Timely involvement of Operations / Construction team to procure and secure packages early. An outline programme has been developed detailing the planning year through to construction. Early engagement with appointed contractor to develop detailed construction phase programme prior to Salix Funding spend year.	3	4	12
7	Planning	SALIX, resource. If project is progress under SALIX finance, potential challenge to resource as project will pursue accelerated timeline to meet SALIX delivery requirements.	5	5	25	All parties to put in place agreed resources with additional secured degree of resilience in the allocation of tasks. All parties to establish a clear governance structure to support the project at appointment.	3	4	12
8	Planning	Long lead time procurement risk increased due to volatile market conditions.	5	5	25	Review with Main Contractor upon appointment to work with supply chain/suppliers to order in advance.  Potential for materials to be stored in contractor compounds/site.	3	3	9
9	Planning	Electrical loadings and grid connection.	4	5	20	Electrical load surveys and consultation with DNO initial engagements already undertaken. Proposal to be agreed with DNO as priority task in programme of the planning year to mitigate potential delay to project start.	2	3	6
10	Planning	Not achieving planning approval causing delays to construction phase.	3	4	12	Early consultation with local planning department upon appointment of design team. To be noted in programme as priority item. Early design works to progress towards preparation of planning application if deemed necessary.	1	4	4
11	Planning	Not achieving building control plans certification causing delays to construction phase.	3	4	12	Preparation of building control application to be undertaken in tandem with design stage. Submission upon complete design.	2	4	8
12	Planning	Risk of inadequate planning leading to disruption from not engaging with all stakeholders due to project timescales.	4	3	12	Communications plan to be developed. Initial stakeholder meeting to be set up upon confirmation of funding to ensure approvals agreed as required.	2	3	6
13	Budget	Budget could be challenged if subject to abnormal inflation or unforeseen costs incurred.	3	4	12	Contingency of 10% has been included as part of the capital build-up. Costs to be updated to account for inflation at next stage.	2	4	8
14	Budget	Salix funding criteria subject to change with future rounds.	5	5	25	Review future rounds funding criteria as soon as available to confirm potential funding eligibility under a successful application.	4	3	12
15	Construction	Works causing disruptions to site activity.	5	4	20	Works plan to be discussed in detail and agreed by all relevant stakeholders upon confirmation of funding.	2	3	6
16	Construction	Works in occupied environment.	5	5	25	Stakeholder meeting to be undertaken to agree construction phase strategy to ensure project can be safely delivered within site confines. Decanting strategy to be agreed if deemed suitable. Should works be required to take place within occupied or partly occupied site, the contractor shall clearly demonstrate how works will be segregated from public, ensuring safety is not compromised to meet project deadlines.	2	5	10
17	Construction	Dust/Noise/General disturbance to adjacent land uses.	5	5	25	Weekly and/or daily notifications to occupants, informing of planned construction activities. Implement additional H&S precautions to protect students and staff. Inform school in advance and agree works programme to allow decanting schedule.	3	4	12
18	Site Safety	General site safety.	3	5	15	All parties to be informed of and act in accordance with their duties under CDM 2015. The Contractor will be required to submit a site-specific construction phase plan demonstrating safe delivery of the works within the required programme period.	2	4	8

Northbrook - Condition Survey

Date: June 2021

Version: 1

Room	Area (m2)	Immediate (H&S)	Immediate (Quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	Total per Room
		£	£	£	£	£	£	£
Inflation		2%	2%	3%	5%	7%	12%	
Entrance Lobby	21.96	-	2,011	18,589	2,934	1,803	356	25,693
Female changing room	67.1	-	12,834	10,819	23,681	30,418	1,671	79,423
Male changing room	42.3	-	7,977	12,349	6,440	34,340	1,671	62,778
Changing room overflow	34.1	-	-	10,465	2,178	956	178	13,776
Lower level corridor	11.33	-	2,145	2,408	363	-	178	5,094
First floor corridor	14	-	1,630	2,067	-	3,980	3,346	11,023
Store	12.8	-	1,001	2,572	2,870	137	1,482	8,061
Office	13.72	-	2,266	2,008	4,292	-	1,068	9,633
Pool	322	-	2,417	-	41,930	80,678	140,395	265,420
Plant room	60	-	-	4,377	4,479	-	4,040	12,896
Major Plant	592	-	-	•	340,100	•	•	340,100
Sub-Total		-	32,280	65,654	429,267	152,310	154,385	833,897
Inflation		-	484	1,970	21,463	10,662	18,526	53,105
Total		-	32,765	67,623	450,731	162,972	172,912	887,003



Northbrook - Condition Survey Date: June 2021

Version: 1

Room: Entrance lobby

RANDALL SIMMONDS

1,803 875 303 412 211 4,641 3,341

> 410 356

1,967 10,043 £25,693

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit		Ceiling Height	Notes
Entrance	Entrance lobby	3.6	6.1	-	-	-	21.96	2.5	
	1	I			Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Carpet Tiles	A					✓		
Walls Decoration	Painted	В				✓			
Walls Repair	Plaster	В				✓			Light cracking
Ceiling Decoration	Painted	В				✓			
Ceiling Repair	Plaster	В				✓			Light cracking
Windows	Timber Single Glazed	С			✓				Glazing potentially not toughened - H&S
Doors	Timber Single Glazed	С			✓				Poor condition
Skirting	Painted Timber	В				✓			
Lighting	Fluorescent Tubes	В		✓					1nr fitting failed
Lighting	Fluorescent Tubes	В				✓			
Small Power	Wall Sockets	В						✓	
Air Conditioning	N/A								
Air Handling	N/A								
Flooring	Entrance Matting	С			✓				
Flooring	Carpet to Reception	С		<b>√</b>					
Reception Counter	Timber Painted	С			✓				Dated and poor condition generally

#### Pricina

Item	Description	Quantity	Unit	Rate	Total	or	No. of Men	Labour Rate	Prod	MATLS
6-10yrs	Replace existing carpet	19	m2	95	1,803					
3-5ys	Redecorate walls	49	m2	18	875					
3-5ys	Replaster walls (allowance for repairs)	19	m2	16	303					
3-5ys	Redecorate ceiling	22	m2	19	412					
3-5ys	Replaster ceiling (allowance for repairs)	9	m2	24	211					
1-2yrs	Replace existing windows	6	m2	774	4,641					
1-2yrs	Replace existing doors	2	nr	1,671	3,341					
3-5ys	Replace skirting board & paint	19	m	37	723					
Immediate (quality)	Replace existing fluorescent tube	1	nr	43	43					
3-5ys	Replace existing light fittings	3	nr	137	410					
11-15yrs	Replace existing wall sockets	2	nr	178	356					
					-					
					-					
1-2yrs	Replace existing entrance matting	3	m2	188	565					
Immediate (quality)	Replace existing reception carpet	19	m2	104	1,967					
1-2yrs	Replace existing reception counter	3	m	3,348	10,043					
			Total		25,693				Total	

#### ney

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R		Isolated repair

Room: Female Changing Room

Changing Room RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes
Changing Room	Female Changing Room	11	6.1	-	-	-	67.1	2.4	
	I				Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Tiles	С		<b>√</b>					Grout failed, chipped/ broken tiles
Walls Decoration	Painted	В				✓			Flaking to paint
Walls Repair	Plaster	С				✓			Blown plaster 5m2
Ceiling Decoration	Painted	В				✓			Light cracking
Ceiling Repair	Plaster	В				✓			Cracking
Windows	Steel Frame, Georgian Wired	В					1		Operation not tested
Doors	Timber Painted	В				✓			Isolated damage
Skirting	N/A								
Lighting	Fluorescent Tubes	В		√R					1nr fitting failed
Lighting	Fluorescent Tubes	В				✓			
Small Power	N/A								
Air Conditioning	N/A								
Air Handling	Extraction	-							Not in use
Wall Tiles	Ceramic	С			✓				Cracked/ blown tiles 30m2
Lockers	Metal	В		<b>√</b>					1nr lock missing
Lockers	Metal	В					✓		32nr
Mirror	Glazed	В			<b>√</b>				Deterioration to finish
Sanitary Ware	Ceramic	В				1			Dated
Sanitary Ware	Ceramic	В				✓			Dated
Baby Change Unit	Wall mounted	В						✓	
Radiators	Steel painted	С			✓				Corrosion to finish
Showers	Timed flow	В					✓		
Shower Screen	Steel frame, Georgian wired	В			<b>√</b>				
Seating	Timber Bench	В				✓			Corrosion to legs
Cubicles	Timber Painted	С				✓			Damage to partition
Basin Worktop	Laminated Timber	С			<b>√</b>				Damaged/ wom

## Pricina

Item	Description	Quantity	Unit	Rate	Total	or	Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
Immediate (quality)	Replace existing floor tiles	67	m2	187	12,567							-	12,567
3-5ys	Redecorate walls	117	m2	18	2,113								2,113
3-5ys	Replaster walls (allowance for repairs)	33	m2	16	513							-	513
3-5ys	Redecorate ceiling	67	m2	19	1,260							-	1,260
3-5ys	Replaster ceiling (allowance for repairs)	27	m2	19	506							-	506
6-10yrs	Replace existing windows	7	m2	774	5,198							-	5,198
3-5ys	Replace existing doors	3	nr	956	2,867							-	2,867
					-							-	-
Immediate (quality)	Replace existing light fittings	1	nr	202	202							-	202
3-5ys	Replace existing light fittings	7	nr	202	1,411							-	1,411
					-							-	-
												-	
					-							-	
1-2yrs	Replace wall tiles	21	m2	165	3,416							-	3,416
Immediate (quality)	Replace existing lockers	1	nr	65	65							-	65
6-10yrs	Replace existing lockers	32	nr	520	16,640							-	16,640
1-2yrs	Replace mirror(s)	2	m2	155	248							-	248
3-5ys	Replace existing wc	1	nr	600	600							-	600
3-5ys	Replace existing whb	1	nr	589	589							-	589
11-15yrs	Replace baby change unit	1	nr	1,671	1,671							-	1,671
1-2yrs	Replace existing radiators	3	nr	227	681							-	681
6-10yrs	Replace existing showers	5	nr	1,716	8,580							-	8,580
1-2yrs	Replace shower screens	4	m2	1,333	5,330							-	5,330
3-5ys	Replace existing timber bench	15	m	709	10,628							-	10,628
3-5ys	Replace existing cubicles	4	nr	799	3,197							-	3,197
1-2yrs	Replace basin worktop	2	nr	572	1,144							-	1,144
			Tota		79,423					Tota	1	£0	£79,423

#### ney

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Male Changing Room

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit		Ceiling Height	Notes
Changing Room	Male Changing Room	9	4.7	-	-	-	42.3	2.5	

## Pricina

					Replaceme	nt period			1
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Tiles (60%)	С		1					Grout failed
Walls Decoration	Painted	В				1			Flaking to paint
Walls Repair	Plaster	В				1			Failure to isolated areas 5m2
Ceiling Decoration	Painted	В				1			Cracking/ failures to isolated areas 5m2
Ceiling Repair	Plaster	В				1			Cracking
Windows	N/A								
Doors	Timber Painted	В					✓		Isolated damage
Skirting	N/A								
Lighting	Fluorescent Tubes	В		√R					1nr fitting loose
Lighting	Fluorescent Tubes	В					✓		
Flooring	Vinyl (40%)	В				1			
Roof Lights	Steel Frame, Georgian Wired	С		<b>√</b>					2nr cracked panes
Lockers	Metal	В		<b>√</b>					1nr lock missing
Lockers	Metal	В					<b>√</b>		32nr
Coat Hooks	Metal	С	<b>√</b>	<b>√</b>					Snapped, sharp edges - H&S
Mirror	Glazed	В			✓				Deterioration to finish
Sanitary Ware	Ceramic	В				1			Dated
Sanitary Ware	Ceramic	В				1			Dated
Baby Change Unit	Wall mounted	В						1	
Radiators	Steel painted	В					<b>✓</b>		Corrosion to finish
Showers	Timed flow	С			<b>√</b>				Poor flow rate
Shower Screen	Steel frame, georgian wired	С			1				1nr cracked pane
Seating	Timber Bench	В					✓		
Entrance Screen	Laminated Timber	В		√R					Secure loose fixing to floor
Entrance Screen	Laminated Timber	В					✓		

Item	Description	Quantity	Unit	Rate	Total
Immediate (quality)	Replace existing floor tiles	25	m2	187	4,753
3-5ys	Redecorate walls	107	m2	18	1,922
3-5ys	Replaster walls (allowance for repairs)	43	m2	16	665
3-5ys	Redecorate ceiling	42	m2	19	794
3-5ys	Replaster ceiling (allowance for repairs)	17	m2	19	319
6-10yrs	Replace existing doors	4	nr	956	3,822
Immediate (quality)	Refix loose light fitting	1	nr	46	- 46
6-10yrs	Replace existing light fittings	6	nr	202	1,209
3-5ys	Replace existing vinyl	17	m2	82	1,389
Immediate (quality)	Replace existing roof lights	2	m2	975	1,560
Immediate (quality)			nr	65	65
6-10yrs	Replace existing lockers	32	nr	520	16,640
Immediate (quality)	Replace existing coat hooks	30	nr	46	1,365
1-2yrs	Replace existing mirrors	1	m2	155	155
3-5ys	Replace existing wc	1	nr	537	537
3-5ys	Replace existing whb	1	nr	815	815
11-15yrs	Replace baby change unit	1	nr	1,671	1,671
6-10yrs	Replace existing radiators	3	nr	227	681
1-2yrs	Replace existing showers	4	nr	1,716	6,864
1-2yrs	Replace shower screens	4	m2	1,333	5,330
6-10yrs	Replace existing timber bench	15	m	709	10,628
Immediate (quality)	Secure loose fixings to floor	4	nr	47	187
6-10yrs	Replace entrance screen	4	m2	377	1,361
			Total		62,778

Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
					-	4,75
						1,92
					-	66
					-	79
					-	31
					-	-
					-	3,82
					-	
					-	4
					-	1,20
					-	1,38
					-	1,56
					-	6
					-	16,64
					-	1,36
					-	15
					-	53
					-	81
					-	1,67
					_	68
					-	6,86
					-	5,33
						10,62
					-	18
			1			1,36
	<u> </u>	-1	То	tal	_	£62,77

RANDALL SIMMONDS

Reference	Condition	Description
New	A	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	Ε	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life.  Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Changing Overflow

RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit		Ceiling Height	Notes
Changing Room	Changing Overflow	6.2	5.5	i -	-	-	34.1	2.4	
					Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Vinyl	В				✓			Stained, wom
Walls Decoration	Painted	с			✓				Marked
Walls Repair	Plaster	В			✓				Re-plaster all
Ceiling Decoration	Painted	с			✓				Water ingress
Ceiling Repair	Plaster	с			✓				Re-plaster all
Windows	N/A								
Doors	Timber Painted	В					✓		Finish marked
Skirting	Timber Painted	с			✓				Replace all
Lighting	Fluorescent Tubes	В				✓			Dated fittings
Small Power	Wall sockets	В						✓	
Air Conditioning	N/A								
Air Handling	N/A								
Roof Lights	Steel Frame, Georgian Wired & polycarbonate	С			✓				
Radiators	Steel painted	В				<b>√</b>			Corrosion/ damage to finish

## Pricina

Item	Description	Quantity	Unit	Rate	Total	or	Hours	No. of Men	Labour Rate	Prod	MATLS
3-5ys	Replace existing vinyl	14	m2	82	1,119						
1-2yrs	Redecorate walls	56	m2	18	1,013						
1-2yrs	Replaster walls	93	m2	16	1,446						
1-2yrs	Redecorate ceiling	34	m2	19	640						
1-2yrs	Replaster ceiling	34	m2	19	643						
					-						
6-10yrs	Replace existing doors	1	nr	956	956						
1-2yrs	Replace skirting board & paint	23	m	37	872						
3-5ys	Replace existing light fittings	3	nr	202	605						
11-15yrs	Replace existing wall sockets	1	nr	178	178						
					-						
1-2yrs	Replace existing roof lights	6	m2	975	5,850						
3-5ys	Replace existing radiators	2	nr	227	454						
<u> </u>		•	Total	1	13,776			·	·	To	tal

Hour	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
					-	1,11
						1,01
					-	1,44
					-	64
					-	64
						-
						95
					-	87
						60
					-	17
					-	-
					-	5,85
						45
	•		Total		4	0 £13,77

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Lower Level

RANDALL SIMMONDS

1,671

137 178

416 227 £5,094

MATLS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes
Corridor	Lower Level	4.2	3.3	2.3	1.1	OMIT	11.33	2.5	
	•								
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Vinyl	С		✓					Heavily wom
Walls Decoration	Painted	С		<b>√</b>					Poor
Walls Repair	Plaster	С		<b>√</b>					Poor
Ceiling Decoration	Painted	В			✓				Light cracking
Ceiling Repair	Plaster	В			✓				
Windows	N/A								
Doors	Timber Single Glazed	С			✓				Previous/ temporary repair. Glazing potentially not toughened - H&S
Skirting	N/A								
Lighting	Fluorescent Tubes	В				✓			
Small Power	Wall sockets	В						✓	
Air Conditioning	N/A								
Air Handling	N/A								
Shelving	Timber	С			✓				Not secured
Radiators	Steel painted	В				<b>√</b>			Corrosion/ damage to finish

## Pricina

Item	Description	Quantity	Unit	Rate	Total	or	Hours	No. of Men	Labour Rate	Prod	Ī
Immediate (quality)	Replace existing vinyl	11	. m2	78	883						Ī
Immediate (quality)	Redecorate walls	38	m2	18	677						Ī
Immediate (quality)	Replaster walls	38	m2	16	585						Ī
1-2yrs	Redecorate ceiling	11	. m2	19	213						
1-2yrs	Replaster ceiling (allowance for repairs)	5	m2	24	109						
					-						
1-2yrs	Replace existing doors	1	nr nr	1,671	1,671						
					-						I
3-5ys	Replace existing light fittings	1	nr	137	137						I
11-15yrs	Replace existing wall sockets	1	. nr	178	178						I
					-						Ī
					-						Ī
1-2yrs	Replace existing timber shelving	2	m	208	416						Ī
3-5ys	Replace existing radiators	1	. nr	227	227						Ī
			Total		5,094					Total	

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R		Isolated repair

Northbrook - Condition Survey Date: June 2021 Room: First Floor (inc. Stairs)

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4	Room	Ceiling
Version: 1								
Date: June 2021								

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	or Omit	Area	Height	Notes
Corridor	First Floor (inc. Stairs)	10	1.4	-	-	-	14	2.5	
	•			•	Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Vinyl	В			√R				Weld failed to corner
Flooring	Vinyl	В					✓		
Walls Decoration	Painted	С			✓				Marked
Walls Repair	Plaster	В			√R				Cracked/ blown 5m2
Ceiling Decoration	Painted	В			✓				Light cracking
Ceiling Repair	Plaster	В			✓				
Windows	N/A								
Doors	External Steel	A						✓	
Skirting	N/A								
Lighting	Fluorescent Tubes	В					✓		
Small Power	Wall sockets	В						✓	
Air Conditioning	N/A								
Air Handling	N/A								
Flooring	Vinyl to stairs	С		<b>√</b>					Torn/ wom
Boxing	Timber Painted	С		<b>√</b>					Failed
Handrails/ Balustrades	Steel Painted	В			√R				Paint flaking
Handrails/ Balustrades	Steel Painted	В					1		
Stair Nosings	Aluminium	С		<b>√</b>					Grip tape worn
Radiators	Steel painted	В					✓		Corrosion/ damage to finish

## Pricina

Item	Description	Quantity	Unit	Rate	Total
1-2yrs	Weld repairs to vinyl	3	m2	46	137
6-10yrs	Replace existing vinyl	14	m2	78	1,091
1-2yrs	Redecorate walls	57	m2	18	1,029
1-2yrs	Replaster walls (allowance for repairs)	23	m2	16	356
1-2yrs	Redecorate ceiling	14	m2	19	263
1-2yrs	Replaster ceiling (allowance for repairs)	6	m2	24	135
					-
11-15yrs	Replace existing external doors	1	nr	2,990	2,990
					-
6-10yrs	Replace existing light fittings	1	nr	137	137
11-15yrs	Replace existing wall sockets	2	nr	178	356
					-
					-
Immediate (quality)	Replace vinyl to stairs	7	m2	74	550
Immediate (quality)	Replace timber boxing & paint	2.5	m	81	202
1-2yrs	-2yrs Repaint handrails and balustrades		m	21	149
6-10yrs	Replace handrails and balustrades	4	m	722	2,525
Immediate (quality)	Replace stair nosing	14	m	63	877
6-10yrs	Replace existing radiators	1	nr	227	227
			Total		11.023

Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
					-	13
					-	1,09:
						1,029
					-	35
					-	26
					-	13
					-	-
					-	2,99
					-	
					-	13
					-	35
					-	-
					-	-
					-	55
					-	20
					-	14
					-	2,52
					-	87
					-	22
			То	tal	£0	£11,02

RANDALL SIMMONDS

#### Key

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Store

RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes
Store	Store	6.4	2				12.8	2.6	
	•				Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Screed	В						✓	
Walls Decoration	Painted	с				✓			
Walls Repair	Brickwork	В				✓			
Ceiling Decoration	Painted	В				✓			
Ceiling Repair	Concrete	В				<b>√</b>			Cracking
Windows	N/A								
Doors	Painted Timber	С		✓					Damaged
Skirting	N/A								
Lighting	Fluorescent Tubes	В					1		
Small Power	Wall sockets	В						✓	
Air Conditioning	N/A								
Air Handling	N/A								
Shelving	Timber	С			✓				
Cleaners Sink	Steel	С		√R					Poorly secured
Cleaners Sink	Steel	С			✓				
Pipework	Copper/ Steel	В			✓				Renew insulation where required
Comms Cab	Floor Cabinet	ļ.							Note

## Pricina

Item	Description	Quantity	Unit	Rate	Total
11-15yrs	Isolated / patch repair to concrete, apply latex screed	13	m2	13	169
3-5ys	Redecorate brickwork walls	44	m2	25	1,086
11-15yrs	Repoint brickwork (allowance for repairs)	17	m2	65	1,136
3-5ys	Redecorate concrete ceiling	13	m2	22	284
3-5ys	Isolated repair to concrete ceiling, breakout loose concrete, rub down reinforcement and apply anti corrosion inhibitor (investigation required)	1	PS	1,500	1,500
Immediate (quality)	Replace existing doors	1	nr	956	951
					-
6-10yrs	Replace existing light fittings	1	nr	137	137
11-15yrs	Replace existing wall sockets	1	nr	178	178
					-
1-2yrs	Replace existing shelving	8	m	208	1,664
Immediate (quality)	Refix existing sink	1	nr	46	41
1-2yrs	Replace existing sink	1	nr	670	670
1-2yrs	Replace insulation to pipework	15	m	16	238

or	Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
						-	169
							1,086
						-	1,136
						-	284
						-	1,500
						-	-
						-	956
						-	-
						-	137
						-	178
						-	-
						-	-
						-	1,664
						-	46
						-	670
			1			_	238
						_	-
			-1	To		£0	

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Office

RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes
Office	Office	4	4	1.9	1.2	OMIT	13.72	2.5	
					Replacement	period			
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Carpet Tiles	С		<b>√</b>					Heavily wom
Walls Decoration	Painted	С		<b>√</b>					Poor
Walls Repair	Plaster	С		<b>√</b>					Poor
Ceiling Decoration	Painted	В			✓				Light cracking
Ceiling Repair	Plaster	В			✓				Blown 3m2
Windows	Steel Frame, Georgian Wired	С				✓			Operation not tested
Doors	Painted Timber	с				✓			Damage to face
Skirting	Tiled	С			✓				Poor
Lighting	Fluorescent Tubes	С		✓					1nr failed tube
Small Power	Wall sockets	В						✓	
Air Conditioning	N/A								
Air Handling	Steel ductwork	-							
Shelving	Timber	В				✓			Not secured
Kitchenette	Basin / Worktop	С			✓				Poor

## Pricing

Item	Description	Quantity	Unit	Rate	Total	or	Hours	No. Mei
Immediate (quality)	Replace existing carpet	14	m2	95	1,304			
Immediate (quality)	Redecorate walls	32	m2	13	422			
Immediate (quality)	Replaster walls	32	m2	16	504			
1-2yrs	Redecorate ceiling	14	m2	14	197			
1-2yrs	Plaster repair works to ceiling	3	m2	24	72			
3-5ys	Replace existing windows	2	m2	774	1,191			
3-5ys	Replace existing doors	1	nr	1,021	1,021			
1-2yrs	Replace skirting board & paint	13	m	37	481			
Immediate (quality)	Replace existing light fittings	1	nr	36	36			
11-15yrs	Replace existing wall sockets	6	nr	178	1,068			
					-			
					-			
3-5ys	Replace existing shelving	10	m	208	2,080			
1-2yrs	Replace existing basin / worktop / sink	1	nr	1,257	1,257			
			Total		9.633			

Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
					-	1,304
						422
						504
						197
						72
					-	1,191
						1,021
					-	481
						36
						1,068
						-
						-
						2,080
						1,257
			То	tal	£0	£9,63

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Date: June 2021

Version: 1

Northbrook - Condition Survey Room: Pool Area RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes	Pricino	1											
Pool	Pool Area	23	3 1	4			322	4.3	2		•											
•	•			•	Replacemen	t period	•															
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs		Item	Description	Quantity	Unit	Rate	Total	or Hours	No. of Men	Labour Rate	Prod	MATLS	Total	Overall Total
Flooring	Tiles	В		√R					Chipped, grout failed to isolated areas	Immediate (quality)	Repairs to floor tiles	10	) m2	215	2,154						-	2,154
Flooring	Tiles	В				✓				3-5ys	Replace existing tiles (pool surround)	13	9 m2	187	26,033						-	26,033
Walls Decoration	N/A														-						-	-
Walls Repair	Brickwork	В				√R			Minor damage, repointing req'd to approx 25m2	3-5ys	Repointing existing brickwork	2!	5 m2	65	1,625						-	1,625
Walls Repair	Brickwork	В						✓		11-15yrs	Repointing existing brickwork	124	4 m2	65	8,081						-	8,081
Ceiling Decoration	N/A														-						-	
Ceiling Repair	N/A														-						-	-
Windows	Aluminium Double-Glazed	В						✓	Operation not tested	11-15yrs	Replace existing windows	19.2	2 m2	774	14,851						-	14,851
Doors	External Aluminium	В						1	Operation not tested	11-15yrs	Replace existing external doors		5 nr	1,021	6,123						-	6,123
Skirting	N/A														-						-	-
Lighting	Fluorescent Tubes	В		√R					4nr failed fittings	Immediate (quality)	Replace existing fluorescent tube		1 nr	66	263						-	263
Lighting	Fluorescent Tubes	В				✓				3-5ys	Replace existing light fittings	20	) nr	202	4,030						-	4,030
Small Power	N/A														-						-	-
Air Conditioning	N/A	-													-						-	-
Air Handling	Extraction	-							Not in use						-						-	-
Roof	Cladding Sheets	В						✓	Inspection limited to ground level	11-15yrs	Replace cladding sheets to roof	32	2 m2	204	65,720						-	65,720
Windows	Polycarbonate Sheet	В					1			6-10yrs	Replace polycarbonate sheets	140	) m2	475	66,508						-	66,508
Seating	Timber Bench	В					1		1nr bowed plank	6-10yrs	Replace timber benches	20	) m	709	14,170						-	14,170
Pool Edging	Coping Stones	В						✓	Light wear	11-15yrs	Replace coping stones to pool edge	5	7 m	806	45,620						-	45,620
Coping Stones	Top of masonry wall	В				√R			Light cracking to mortar	3-5ys	Repointing coping stones to masonry wall	74	4 m2	65	4,810						-	4,810
Coping Stones	Top of masonry wall	В						✓		3-5ys	Replace coping stones to masonry wall	74	4 m	73	5,431						-	5,431
KeV	=												Tota	ıl	265,420				Tota	ıl	_	£265,420



Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R	-	Isolated repair

Room: Plant Room

RANDALL SIMMONDS

Space Description	Description	Wall 1 (m)	Wall 2 (m)	Wall 3 (m)	Wall 4(m)	Add 3x4 or Omit	Room Area	Ceiling Height	Notes
Plant Room	Plant Room	10	6				60	2.5	
	•	•			Replacement	period		•	
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs	
Flooring	Concrete	В						<b>√</b>	
Walls Decoration	Painted	с				✓			
Walls Repair	Brickwork	В						✓	
Ceiling Decoration	Painted	С			✓				
Ceiling Repair	Concrete	С			√R			✓	Corrosion to steel reinforcement
Windows	Steel Sash / Timber Frame	С			✓				Frame subject to rot, paint failed
Doors	External Steel	С						✓	Isolated areas of corrosion, surface deteriorated
Skirting	N/A								
Lighting	Fluorescent Tubes	В				✓			
Small Power	N/A								
Air Conditioning	N/A	-							
Air Handling	N/A	-							
Plant	Various	-							Not tested

P				
	rı	$\sim$	n	$\sim$

Item	Description	Quantity	Unit	Rate	Total
11-15yrs	Isolated / patch repair to concrete, apply latex levelling screed	60	m2	13	79
3-5ys	Redecorate brickwork walls	80	m2	25	1,99
3-5ys	Repoint brickwork (allowance for repairs)	32	m2	65	2,08
1-2yrs	Redecorate concrete ceiling	60	m2	22	1,33
1-2yrs	Isolated repair to concrete ceiling, breakout loose concrete, rub down reinforcement and apply anti corrosion inhibitor (investigation required)	1	PS	1.500	1.50
1-2yrs	Replace existing windows		m2	774	1,54
11-15yrs	Replace existing external doors	1	nr	3,250	3,25
					-
3-5ys	Replace existing light fittings	3	nr	137	41
					-
					-
					-
					-
			Tota	ı	12,89

Hours	No. of Men	Labour Rate	Prod	MATLS	Total		Overall Total
							790
							1,990
							2,080
						-	1,330
							1,500
						-	1,547
							3,250
						-	-
						-	410
							-
							-
						-	-
						-	-
	•	•	Total			£0	£12,89

Reference	Condition	Description
New	А	As new or very recent
Good	В	In a good condition with no appreciable defects or wear. No repairs required.
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.
√R		Isolated repair

Northbrook - Condition Survey Room: Major Plant
Date: June 2021
Version: 1

Space Description Description Wall 1 (m) Wall 2 (m) W Pricing

	1	1	1	1	•			
					Replacemen	t period		
Element	Description	Condition	Immediate (H&S)	Immediate (quality)	1-2yrs	3-5ys	6-10yrs	11-15yrs
Boiler replacement						<b>√</b>		
Pump set replacement						✓		
Hot water storage						✓		
Cold water storage						✓		
Hot water distribution						✓		
Cold water distribution						✓		
Air handling system						✓		
Duct work cleaning						✓		
Consumer panels Electrical distribution						✓		
boards						✓		
Electrical distribution						✓		
Emergency lighting						✓		
Fire alarm replacement Security alarm						✓		
replacement						✓		
Data replacement						✓		
		-						

Item	Description	Quantity	Unit	Rate
3-5ys	Boiler replacement	1	item	43,9
3-5ys	Pump set replacement	1	item	5,2
3-5ys	Hot water storage	1	item	23,1
3-5ys	Cold water storage	1	item	15,4
3-5ys	Hot water distribution	1	item	11,6
3-5ys	Cold water distribution	1	item	11,6
3-5ys	Air handling system	1	item	96,3
3-5ys	Duct work cleaning	1	item	5,2
3-5ys	Consumer panels	1	item	25,4
3-5ys	Electrical distribution boards		inc	
3-5ys	Electrical distribution	1	item	23,9
3-5ys	Emergency lighting	1	item	7,7
3-5ys	Fire alarm replacement	1	item	23,1
3-5ys	Security alarm replacement	1	item	15,4
3-5ys	Data replacement	1	item	32,3

## ney

Reference	Condition	Description	
New	А	As new or very recent	
Good	В	In a good condition with no appreciable defects or wear. No repairs required.	
Satisfactory	С	Subject to general wear and tear, still serviceable and functioning adequately. Maintenance/ minor repairs required.	
Fair	D	Subject to several years wear and tear, still serviceable. Repair work now necessary.	
Dilapidated/ Poor	E	Subject to hard long term wear or damaged. Having reached or nearing the end of its useful life. Extensive repair and replacement now required.	
√R	-	Isolated repair	