



MOT Test Number

325861161023

Vehicle Registration Mark

SB06NUU

Vehicle Identification Number

VF3BARHWP86267569

Make

PEUGEOT

Model

EXPERT

Colour

Blue

Issuer's Name

D. N. CARTER

Test Class

4

Country of Registration

Great Britain

Expiry Date

14 June 2017 (SEVENTEEN)

Issued

13 Jun 2016

Test Station

7026BG

Odometer Reading and History

13 6 2016: 170776 mi
15 6 2015: 153916 mi
9 5 2014: 141643 mi
22 5 2013: 117324 mi

Inspection Authority

TOP MARQUES
PINHOE TRADING ESTATE
VENNY BRIDGE
PINHOE
EXETER
EX4 8JN
01392464640

Additional Information

To preserve the anniversary of the expiry date,
the earliest you can present your vehicle for
test is 15 May 2017.

Signature of Issuer

Advisory Information

001 Steering system has slight free play detected at steering wheel [2.2.A.1b]
002 nearside (outer driveshaft gaiter fouling antiroll bar)

About this document

- 1 This document is a receipt style certificate telling you that an MOT Test pass result has been recorded in the Driver & Vehicle Standards Agency's (DVSA's) database of MOT Test results; this can be verified at www.gov.uk/check-mot-status.
- 2 A test certificate relates only to the condition of the components examined at the time of test. It does not confirm the vehicle will remain roadworthy throughout the validity period of the certificate.
- 3 Check carefully that the details are correct.
- 4 Whilst advisory items listed above do not constitute MOT failure items, they are drawn to your attention for advice.
- 5 For further information about this document, please visit www.gov.uk/getting-an-mot or contact DVSA on 0300 123 9000*.
*Your call may be monitored or recorded for lawful purposes.

TOP MARQUES

VEHICLE EXAMINATION REPORT

YOUR ATTENTION IS DRAWN TO THE TERMS AND CONDITIONS BELOW

The examination of the vehicle described in this report was of a purely external, visual nature and excludes any dismantling. No responsibility can be accepted for defects not visibly present at the time, or those not detected which fall outside the scope of the examination and (where possible) its limited road test. Road tests, when possible, are conducted for a limited duration and exclude high speed testing. The accuracy of the instrumentation within the vehicle (speedometer, odometer, fuel and temperature gauges etc.), cannot be verified, neither can the future life expectancy of the clutch and brake linings, or the failure of mechanical components in the future. Statements on fuel and oil consumption levels will also be excluded.

Report No: TOP006	Inspection Date: 15/06/2016
Customer Details Mr. T Goode 21 Venny Bridge Pinhoe Exeter Devon	Inspection Address Top Marques Pinhoe Exeter Devon EX4 8JN
Telephone: 07967 879090	Telephone: 01392 464640

VEHICLE DETAILS

Make & Model	Peugeot Expert	Registration No.	SB06NUU
Colour	Blue	Engine CC	1997(approx)
Vehicle Identity Number. (VIN No.)	VF3BARHWB86267569		Confirmed Yes
Engine No: DYSX4027834			
V5 Registration doc checked	YES	MOT Certificate Expires	14/06/2016
Odometer Reading	170776 Miles	Service Records Seen	NO

MECHANIC SUMMARY

PLEASE READ ALL THE PAGES OF THE REPORT


Wheel Chair fixing not checked with a wheel chair
Interior light in need of refitting as bracket seems to not fit correctly

TOP ✓ MARQUES

EXTERIOR PANELS

KEY:

A acceptable
 G good
 R repaired
 = scratch
 X dent
 C corrosion
 O chip / rust
 D decals
 P poor condition
 -- not checked

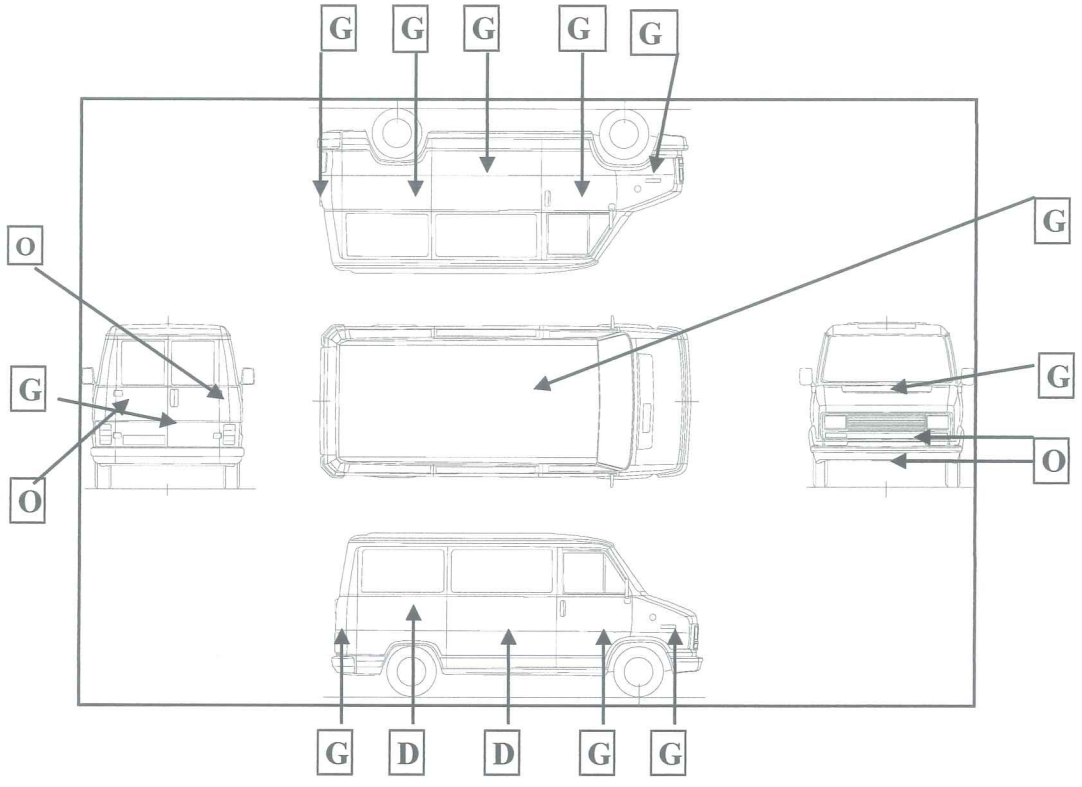

Taxi Colour: **BLUE**

TOP ✓ MARQUES

Minor blemishes, which are acceptable for the vehicle's age and type, are not recorded and you should satisfy yourself in this regard.

EVIDENCE OF BODYWORK REPAIRS **NO** No Major Repairs seen

Comments

Paint is peeling from around the rear door hinges
Has scuff marks on rear read and ¼ panel

KEY FOR POINTS ON FOLLOWING PAGES

- S** **Satisfactory for age and recorded mileage**
- **Could not be checked**
- x** **Needs immediate attention**
- A** **Advisable repair**
- N/A** **Not applicable**
- Y** **Yes**
- N** **No**
- C** **See Engineer's comments**

BODY EXTERIOR

1. Panel Condition/Alignment	S	5. Bumpers No plates – F/R	S	9. Body damage	Y
2. Paintwork	C	6. Door locks – operation	S	10. Corrosion	S
3. Exterior trim	S	7. Fuel filler cover and cap	S	11. Mud flaps None Fitted	N/A
4. Glass	S	8. Elevating Roof (operation/cond..)	N/A	12.	

ENGINE COMPARTMENT Diesel

13. Coolant Level/Condition	S	21. Clutch Fluid	S	29. Accelerator linkage	S
14. Coolant leaks	NO	22. Brake Fluid	S	30. Body panels	S
15. Antifreeze	S	23. Engine Oil level	S	31. Bonnet catch	S
16. Radiator/Cap	S	24. External leaks (engine)	NO	32. Bonnet hinges	S
17. Hoses/Pipes	S	25. Engine mountings	S	33. Cold starting	S
18. Drive Belts	S	26. Fuel Injection	S	34. Fast idle (cold)	S
19. Water Pump	S	27. Turbocharger	S	35. Noise level (cold)	S
20. Power Steering	S	28. Fuel pump/Pipes	S	36. Excess fumes/smoke	NO

Spark plugs, Injectors or Glow Plugs are not removed.

It should be noted that a gas analyser has not been used to check exhaust emissions.

If no documentation is seen indicating camshaft drive belt replacement, to ensure future serviceability, it is important that the belt is replaced immediately and then at intervals specified by the manufacturer. It is in your best interests that you ensure that this is carried out.

TOP ✓ MARQUES

ELECTRICAL / CONTROLS					
37. Starting system/Ignition lock	S	43. Stop lights	S	51. Horn	S
38. Battery charging system	S	44. Indicator/Hazard lights	S	52. Radio/Cass./CD/Aerial	S
39. Voltages at battery:	S	45. Reverse / Fog lights	S	53. Heater(s) / Fan controls	S
normal	S	46. Auxiliary lights	S	54. Air Con operation	S
charging	S	47. Interior / Panel lights	S	55. Door locking	S
40. Headlights	S	48. Screen dimisters SELECT	S	56. Windows	S
41. Sidelights /Running lights	S	49. Mirrors (electric)	S	57. Wipers/Washers	S
42. Rear and No. plate lights	S	50. Controls/Instruments	S	58. Headlamp washers	N/A

INTERIOR / LUGGAGE COMPARTMENT					
59. Steering Wheel/Adjustment	S	66. Door seals /hinges	S	73. Rear parcel shelf/blind	N/A
60. Seat upholstery – F/R	S	67. Interior sills	S	74. Boot/tailgate lock	S
61. Seat adjustment	S	68. Headlining/visors	S	75. Luggage/Load area trim con	S
62. Seatbelts – F/R	S	69. Sun roof(s) Elec.	N/A	76. Illumination light	A
63. Carpets – F/R	N/A	70. Dash panel (condition)	S	77. Tool kit etc	S
64. Door trim panels	S	71. Cigarette lighter(s)	S	78. Living Area (Visual Only)	N/A
65. Door fitting /operation	S	72. Mirrors (internal)	S	79.	

FRONT SUSPENSION / STEERING / UNDERFRAME					
80. Engine underside leakage	NO	85. Wheel hubs/bearings	S	90. Sub-frames/mountings	S
81. Steering joints/ball joints	S	86. Springs/suspension units	S	91. Suspension arms/mountings/joint	S
82. Steering Rack and Pinion	S	87. Sphers/Pipes/Hoses	N/A	92. Tie bars/anti roll bars	S
83. Chassis members	S	88. Dampers (condition / leaks)	S	93. Corrosion protection	S
84. Power steering Hydraulic	S	89. Power steering pipes/gaiters	S	94. Corrosion – floor/chassis	NO

REAR SUSPENSION / UNDERFRAME					
95. Springs/suspension bars	S	99. Location rods/fixings	S	103. Sub-frames/mountings/axles	S
96. Anti roll bar	S	100. Bump stops/gaiters	S	104. Chassis members	S
97. Dampers/bushes	S	101. Wheel hubs/bearings	S	105. Corrosion protection	S
98. Suspension arms/fixings	S	102. Spheres/Pipes/Hoses	N/A	106. Corrosion – floor/chassis	NO

CLUTCH / TRANSMISSION Automatic Gearbox					
107. Fluid/Oil leaks	NO	111. Casings/Axles/Differential(s)	S	115. Backlash	S
108. Cables/adjustments	S	112. Mountings	S	116. Gaiters	S
109. Hydraulic system	S	113. Drive shaft assembly	S	117. Propeller shaft(s)	S
110. Linkage (wear)	S	114. Universal/sliding joints	S	118. Prop. Bearings/Supports	S

EXHAUST SYSTEM					
119. Manifold(s)	S	121. Silencer(s)/Catalyst(s)	S	123. Joints/Couplings	S
120. Pipes	S	122. Heat shields/Mountings	S	124. System condition	GOOD

FUEL SYTEM					
125. Tank	S	127. Fuel lines	S	129. Evidence of leaks	NO
126. Tank fixings	S	128. Breather pipes	--	130.	N/A

TOP ✓ MARQUES

BRAKES

131. Master cylinder security	S	134. Flexible hoses	S	137. Hand/Parkbrake op/adjustment	S
132. Fluid leaks	S	135. Pipes/Connections	S	138. Hand/Parkbrake linkage	S
133. Servo/Power system	S	136. Discs/Pads/Drums	S	139. Pedal/Linkage	S

WHEELS AND TYRES Type

140. Wheel Rims	S	Steel			
141. Wheel Trims	N/A				
Tyres	Make	Size	Type / Construction	Min tread depth	
142. RH Front	Super 2000	205/65/15	Radial/Tubeless	5-6mm	S
143. LH Front	Super 2000	205/65/15	Radial/Tubeless	3-4mm	S
144. RH Rear	Autoguard	205/65/15	Radial/Tubeless	7-8mm	S
145. LH Rear	Mazzini	205/65/15	Radial/Tubeless	7-8mm	S
146.					
147.					
148. Spare					N/A

ROAD TEST

Finish Odom. Reading	170780 Miles	Conditions	Dry
Test Duration	4.1 Miles	Speed achieved up to	30 M.P.H.

149. Final drive op./Noise level	S	156. Instrument/Controls function	S	163. Road holding/Stability	S
150. Gearbox operation/noise level	S	157. Steering wheel alignment	S	164. General steering/Handling	S
151. Engine performance	S	158. Clutch operation	S	165. Footbrake operation	S
152. Engine noise	S	159. 4WD operation	N/A	166. Hand/Parkbrake operation	S
153. Excess smoke	NO	160. Cooling fan operation	--	167. Suspension noise	S
154. Overheating evidence	NO	161. Steering effort	S	168. Warning lights	S
155. Auto changes/Kickdown/Inhib.	S	162. Hot restarting	S	169.	

FINAL CHECK

170. Oil leaks	NO	171. Coolant leaks	NO	172.	
----------------	----	--------------------	----	------	--

Please read all pages of this report

TOP ✓ MARQUES

Essential & Desirable Repairs

It is strongly advised that the essential defects are investigated immediately or rectified prior to purchase of the vehicle and desirable repairs are carried out in the near future. Some defects may prove costly to rectify and this must be considered prior to purchase or authorising any remedial work.

Attention

Some vehicles are provided with a master key, which can be extremely costly to replace (sometimes in excess of £1000) as, in some cases, if the master key is missing the Engine Control Unit (ECU) may have to be replaced should you encounter problems. As well as this, some radios have codes to allow them to operate. Please satisfy yourself that you have all relevant keys and codes. You should also ensure you are given all relevant instruction manuals for the vehicle, radio, alarm and immobilisers as necessary

Item	Defect/Item requiring further investigation /rectification	D/X
------	--	-----

Report Ref: TOP006	Reg. No: SB06NNU	Signed: 	Mechanics Name: Dave Carter	Date: 15/06/2016
-----------------------	---------------------	--	--------------------------------	---------------------